


testo 6383 Ethernet· differential pressure transmitter testo 6610 · Probes

P2A software · Parameterizing, adjusting and analyzing software

Instruction manual Volume 1

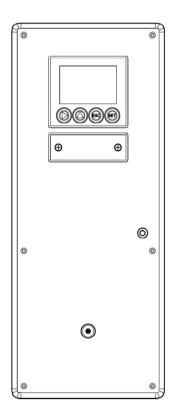

1 Safety and the environment

Avoiding electrical hazards

- Never use the instrument and connected probes to measure on or near live parts!
- > Damaged mains cables must only be replaced by authorized personnel.
- Only have the transmitter wired and connected by authorized personnel with the voltage disconnected.
- You must always comply with the regulations applicable in your country for opening and repairing electrical equipment.

Avoiding personal injury and damage to equipment

- > Installation, setting and calibration work must only be carried out by qualified and authorized personnel!
- Only open the instrument when this is expressly described in the instruction manual for installation, maintenance or repair purposes.
- Observe the permissible storage, transport and operating temperature.
- > Do not store the product together with solvents. Do not use any desiccants.
- > Do not use the instrument for control purposes at the same time as operating or servicing the transmitter.
- Only operate the product properly, for its intended purpose and within the parameters specified in the technical data. Do not use any force.
- Carry out only the maintenance and repair work on this instrument that is described in the documentation. Follow the prescribed steps exactly. Use only original spare parts from Testo.

Any additional work must only be carried out by authorized personnel. Otherwise testo will not accept any responsibility for the proper functioning of the instrument after repair and for the validity of certifications.

Protecting the environment

At the end of its useful life, send the product to the separate collection for electric and electronic devices (observe local regulations) or return the product to Testo for disposal.

2 About this document

Use

- Please read this documentation through carefully and familiarize yourself with the product before putting it to use. Pay particular attention to the safety instructions and warning advice in order to prevent injuries and damage to the products.
- > Keep this document to hand so that you can refer to it when necessary.
- > Hand this documentation on to any subsequent users of the product.

A WARNING	Indicates potential serious injuries
A CAUTION	indicates potential minor injuries

Symbols and writing standards

Representa- tion	Explanation
i	Note: Basic or further information.
1 2	Action: more steps, the sequence must be followed.
>	Action: a step or an optional step.
	Result of an action.
Menu	Elements of the program interface.
[OK]	Buttons of the program interface.
	Functions/paths within a menu.
" "	Example entries

3 Contents

1	Safe	ty and th	ne environment	3
2	Abo	ut this d	ocument	4
3	Con	tents		5
4				
•	4.1.		cations	
	4.1.	•		
			Functions and use	
			Scope of delivery	
			Fechnical data	
			Dimensions	
	4.2.		t description	
			At a glance	
			Jsable probes	
			Display and keypad	
			Service interface	
		4.2.5. F	Relay board (option)	15
		4.2.6. A	Analog outputs	16
		4.2.7. F	Parameters	16
			Scaling	
		4.2.9. A	Alarm handling	19
	4.3.	Commi	ssioning	20
			Mounting preparations	
		4.3.2.	Connecting the instrument	21
		4	I.3.2.1. Overview of terminals	21
		4	I.3.2.2. Connecting voltage supply and analog outputs	22
			I.3.2.3. Connecting the relay outputs	
			I.3.2.4. Connecting pressure connections	
			I.3.2.5. Closing the instrument	
			Ethernet communication	
			I.3.3.1. Types of operation	
			I.3.3.2. Mains connection	
			1.3.3.4. Integration into customer's Ethernet system	
			1.3.3.5. Adjusting the instrument	
			I.3.3.6. Overview: Adjustment keys and test contacts	
			I.3.3.7. 1-point adjustment (offset - humidity/temperature)	
			I.3.3.8. 2-point adjustment (humidity/temperature)	
			I.3.3.9. Analog output adjustment	
		4	I.3.3.10. n-point adjustment (pressure)	45
		4	I.3.3.11. High-humidity adjustment for testo 6614	46
		4	I.3.3.12. Self adjustment of testo 6615 trace humidity probe	47
	4.4.	Operati	ion	49
			Relationship between user menu and mini-DIN socket is active	
			Password protection	
			Structure of user menu	
		4.4.4.	Overview of the testo 6383 user menu	51

	4.4.5.	The individual main menus	54
		4.4.5.1. Editing main menu of channel 1	54
		4.4.5.2. Editing Main Menu Channel 2 (if this option is available)	54
		4.4.5.3. Editing Main Menu Channel 3 (if this option is available)	54
		4.4.5.4. Editing Main Menu Alarm	55
		4.4.5.5. Editing Main Menu Settings	56
		4.4.5.6. Editing Main Menu Analysis	59
		4.4.5.7. Editing Message main menu	61
		4.4.5.8. Calling up Main Menu Ident	62
		4.4.5.9. Editing Main Menu Adjust	62
		4.4.5.10. Editing Reset main menu	65
4.5.	Statu	s, warning and error messages	66
	4.5.1.	Status messages	66
	4.5.2.	Warning messages	68
	4.5.3.	Transmitter error messages	70
	4.5.4.	Handling alarm messages	71
	4.5.5.	Namur fault conditions	73
1.6.	Maint	tenance and cleaning	74
	4.6.1.	Maintaining the instrument	74
	4.6.2.	Cleaning the instrument	

4 Transmitter

4.1. Specifications

4.1.1. Functions and use

The testo 6383 transmitter is suitable for the following applications with Ethernet networking, amongst others:

- · Clean rooms
- Complex room climate applications

In addition to the signal transmission of the readings to a control unit via analog outputs, the measurement data can simultaneously be recorded, documented and visualized via Ethernet. Furthermore, it is possible to issue an alarm for those responsible

Furthermore, it is possible to issue an alarm for those responsible for the process, if necessary.

4.1.2. Scope of delivery

The scope of delivery of the testo 6383 transmitter includes the following:

- With KMAT version D04: Integrated humidity probe
- Sealing frame
- · Instruction manual
- Calibration report

4.1.3. Accessories

The following accessories are available for the testo 6383 transmitter, amongst others:

- Protection caps for probes
- Mains unit
- P2A software (parameterizing, adjusting and analyzing software)
- Assembly accessories



4.1.4. Technical data

Parameters

- Differential pressure
- Temperature
- Humidity

Differential pressure accuracy



The specifications are only valid if the positive pressure is applied at the positive pressure connection.

- 0.3 % of measuring range, additional 0.3 Pa intrinsic error¹
- $T_{K \text{ slope drift}}$ = 0.02 % of measuring range per degree Kelvin of deviation from nominal temperature 22 °C
- T_{K zero point drift}= 0 %, as zeroing with solenoid valve²

Humidity and temperature accuracy

Depends on probe

Humidity and temperature measuring range

Depends on probe

Pressure measuring range, resolution and overload of differential pressure

Pressure measuring range depending on version ordered	Resolution	Overload
0 to 50 Pa	0.1 Pa	20,000 Pa
0 to 50 Pa	0.1 Pa	20,000 Pa
0 to 100 Pa	0.1 Pa	20,000 Pa

 $^{^1}$ Measuring uncertainty in accordance with GUM: $\pm 0.5~\%$ of measuring range final value $\pm 0.3~\text{Pa}.$

The determination of measurement uncertainty takes place according to GUM (Guide to the Expression of Uncertainty in Measurement):For the determination of measurement uncertainty, the accuracy of the measuring instrument (hysteresis, linearity, reproduceability), the uncertainty contribution of the test site as well as the uncertainty of the adjustment site (works calibration are taken into account. For this purpose, the value of k=2 of the extension factor, which is usual in measurement technology is used as a basis, which corresponds to a trust level of 95%.

² Minor mixtures of the media may occur at the positive and negative pressure side due to the automatic zeroing cycle.

Pressure measuring range depending on version ordered	Resolution	Overload
0 to 500 Pa	0.1 Pa	20,000 Pa
0 to 10 hPa	0.01 hPa	200 hPa
-10 to 10 Pa	0.1 Pa	20,000 Pa
-50 to 50 Pa	0.1 Pa	20,000 Pa
-100 to 100 Pa	0.1 Pa	20,000 Pa
-500 to 500 Pa	0.1 Pa	20,000 Pa
-10 to 10 hPa	0.01 hPa	200 hPa

i

Upon delivery and following a factory reset the readings are shown in the display in the unit that was ordered via the KMAT option Fxx, .

Humidity and temperature resolution

0.1 % RH or 0.01 °C/0.01 °F

Meas. cycle

1/sec

Interface


- Mini-DIN for P2A software (parameterizing and adjusting software) and handheld testo 400/650
- Ethernet interface RJ45 (Ethernet 10 BatesT/100)

Voltage supply

 4-wire (separate signal and supply lines): 20 to 30 V AC/DC, 300 mA power consumption

Maximum load

4-wire: 500 Ω (power output)

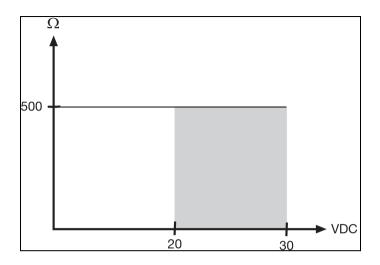

Maximal load

4-wire: 10 kΩ (voltage output)

Analog output

- 0 to 1 V ± 1.5 mV (4-wire) or
- 0 to 5 V \pm 7.5 mV (4-wire) or
- 0 to 10 V ± 15 mV (4-wire) or
- 0 to 20 mA ± 0.03 mA (4-wire) or
- 4 to 20 mA ± 0.03 mA (4-wire)

Resolution of analog output

12 bit

Relay

4 relays, 250 V AC/DC, 3 A (optional)

Display

2-line LCD with plain text line (optional)

Operating temperature

-5 to 50 °C/23 to 122 °F

Storage temperature

-20 to 60 °C/-4 to +140 °F

Oper. humidity

0 to 90 % RH

Housing, weight

- Metal/plastic
- Version with integrated humidity probe: approx. 1.35 kg
- Version with preparation for external humidity probe: approx.
 1.26 kg

Protection class, frontal

 IP 65 only if the transmitter is wired, Ethernet connector is inserted and/or sealing plugs are inserted


Directives, standards and tests

- EC Directive: 2004/108/EC
- DIN 14644-4
- EN 61000-6-2 interference immunity
- EN 61000-6-3 interference emission
- EN 61326-1+A1+A2

Warranty


- · Duration: 2 years
- Warranty conditions: see website www.testo.com/warranty

4.1.5. Dimensions

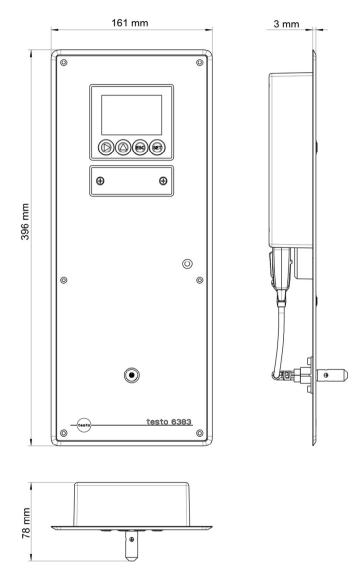


4.2. Product description

4.2.1. At a glance

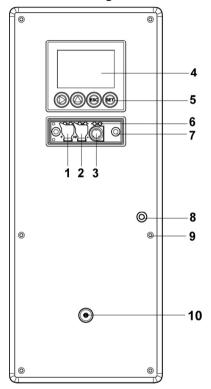

- Sealing plugs on the positive pressure test connection (Ø 4 mm)
- Sealing plugs on the negative pressure test connection (Ø 4 mm)
- 3 Socket for service plug
- 4 Display (optional)
- Keys (only with optional display)
- 6 Test rods for the analog outputs
- 7 Service cover screw connection (self-locking, 2 pcs.)
- 8 Aperture for front pressure connection
- 9 Openings for screws for fastening to the wall
- 10 Only with integrated humidity probe (KMAT option D04): Opening for the integrated humidity probe

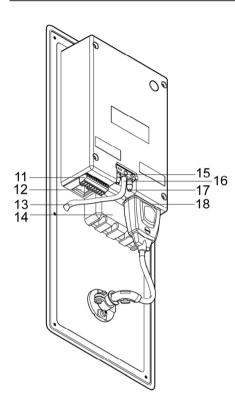

- 11 9-pin connector for the current/voltage supply
- 12 Socket for Ethernet interface
- 13 Front pressure connection hose
- 14 Relay cover with 12-pin connector underneath for relay connection (option)
- 15 Negative pressure connection (Ø 6.4 mm)
- 16 Blind connection as hose holder for front pressure connection hose (Ø 6.4 mm)
- 17 Positive pressure connection (Ø 6.4 mm)
- 18 Probe socket

4.2.2. Usable probes

The testo 6383 transmitter can be used with the following probes:

Probes	Article no.	Characteristic
Integrated humidity probe	KMAT option D04 (0636 6610)	Wall probe version; accuracy to ±1 % RH; temperature range -20 to +70 °C/-4 to +158 °F, plug-on sensor
testo 6613	0555 6610-L13	Cable probe version; accuracy to ±1 % RH; temperature range -70 to +180 °C/ -94 to+356 °F, sensor soldered
testo 6614	0555 6610-L14	Heated cable probe version; accuracy to ±1.0 % RH; temperature range -40 to +180 °C/ -40 to +356 °F, sensor soldered

Probes	Article no.	Characteristic
testo 6615	0555 6610-L15	Trace humidity cable probe version; accuracy ±1 K at 0 °Ctd/+32 °Ftd; temperature range -40 to 120 °C/-40 to +248 °F, sensor soldered
testo 6617	0555 6610-L17	Cable with cover electrode monitoring probe version; accuracy to ± 1.2 % RH; temperature range -40 to 180 °C/ -40 to +356 °F, sensor soldered

4.2.3. Display and keypad

The display option allows operation of the testo 6383 transmitter via the display and four keys.

The LCD display consists of two 7-segment lines for displaying readings and units and of an information line (for status messages, for example).

The brightness and contrast of the display and the background lighting (permanent or off) can be changed via the user menu or the P2A software.

4.2.4. Service interface

The parameterizing socket (mini-DIN) is located behind the service flap as an interface to the P2A software or Testo handheld instrument (testo 400/testo 650).

4.2.5. Relay board (option)

This has a floating switch capacity of 250 V AC/3 A. The switching limits and hysteresis as well as the function as relay for the collective alarm can be set via the display or the P2A software.

Further features include:

- Function of changeover contacts (NC/NO contacts) freely selectable
- 12 terminals for a total of 4 relays.
- If no relays are available, settings for monitoring limit values or alarms can still be controlled via the display. The alarm status will be shown on the display.
- Only have the transmitter wired and connected by authorized personnel with the voltage disconnected.

4.2.6. Analog outputs

As analog outputs, the testo 6383 has either

- 1 or optionally 3 current outputs of 0 to 20 mA (4-wire)/4 to 20 mA (4-wire) or
- 1 or optionally 3 voltage outputs of 0 to 1 V/0 to 5 V/0 to 10 V (4-wire).

The transmitter can be ordered with three analog outputs as an option.

The optional three channels are galvanically isolated.

4.2.7. Parameters

The following parameters are displayed

- Differential pressure in Pa, hPa, kPa, mbar, bar, mmH₂O, inch H₂O, inch HG, kg/cm², PSI
- Relative humidity in % RH (technical)
- Relative humidity in % WMO* (calculation according to the WMO standard)
- Degree of humidity in g/kg and gr/lb
- Absolute humidity in g/m³ and gr/ft³
- Water content in ppm (vol) and % vol
- Psychrometer temperature in °C_{tw} and °F_{tw}
- Enthalpy in kJ/kg and BTU/lb
- Water vapour partial pressure in hPa and inch H₂O
- Dewpoint temperature in °C_{td} and °F_{td}
- Standardized dewpoint in °CtdA, standardized at atmospheric pressure (1013 hPa); precondition: Absolute process pressure.
- Dewpoint of H₂O₂ mixture in °C_{tm} and °F_{tm}
- Mixture humidity H₂O₂ in %RH_m.
- * It is possible that condensation appears as of a displayed humidity starting from 70 % and is shown on the display. This unit is used in meteorology, amongst others. When calculating the relative humidity the Magnus coefficient with undercooled water is used in accordance with WMO.
- Calculated humidity variables correspond to the medium of air. With other gases/gas compositions, deviations may occur, e.g. with the enthalpy.
- Temperature °C and °F

4.2.8. Scaling

There are three types of min./max. values:

- 1 The measuring range: The maximum sensor performance is in this range. Values outside of the measuring range are displayed via messages, for example. Measuring range, see table (below).
- 2 Standard scaling: The output signals are assigned to this measuring range as standard:
 - during delivery if no entries are made in the order code
 - after exchanging the unit, the measuring range recorded in the instrument is applied as standard.
- The transmitter even retains its scaling with the voltage disconnected.

Measuring range, see table (below).

- 3 The maximum settings for the manual scaling
 - The maximum limits can be calculated as follows:
 - X = difference between MIN. and MAX. value of the standard scaling
 - (Max. value of standard) + (50 % of X)
 - (Min. value of standard) (50 % of X)
 - It is thus possible to scale beyond the measuring range, e.g. for the adjustment of the scaling limits to standard values of a PLC.

With the alarm definition, however, the physical measuring range limits are decisive.

Measuring range/standard scaling	Maximum scaling
0 to 50 Pa	-5 to 15 Pa
0 to 50 Pa	-25 to 75 Pa
0 to 100 Pa	-50 to 150 Pa
0 to 500 Pa	-250 to 750 Pa
0 to 10 hPa	-5 to 15 hPa
-10 to 10 Pa	-20 to 20 Pa
-50 to 50 Pa	-100 to 100 Pa
-100 to 100 Pa	-200 to 200 Pa
-500 to 500 Pa	-1000 to 1000
-10 to 10 hPa	-20 to 20 hPa

Parameter	Unit	Probes	Physical measuring range at 1013 hPa		Standard scaling of transmitter measuring range	
			MIN	MAX	MIN	MAX
Temperature	°C	6611	-20	+70	-20	+70
	°F	6611	-4	+158	-4	+158
	°C	6613	-70	+180	-70	+180
	°F	6613	-94	+356	-94	+356
	°C	6614, 6617	-40	+180	-40	+180
	°F	6614, 6617	-40	+356	-40	+356
	°C	6615	-40	+120	-40	+120
	°F	6615	-40	+248	-40	+248
Dewpoint	$^{\circ}C_{td}$	6611	-20	+70	-80	+100
	°F _{td}	6611	-4	+158	-112	+212
	°C _{td}	6613, 6614, 6617	-20	+100	-80	+100
	°F _{td}	6613, 6614, 6617	-4	+212	-112	+212
	$^{\circ}C_{td}$	6615	-60	+30	-80	+100
	°F _{td}	6615	-76	+86	-112	+212
Absolute humidity	g/m ³	all probes	0	600	0	2000
	gr/ft ³	all probes	0	250	0	800
relative humidity ³	% RH	all probes	0	100	0	100
WMO relative humidity ³	% RH		0	100	0	100
Mixture humidity H ₂ O ₂	% RH _m		0	100	0	100

 $^{^3}$ For constant use in high humidity (> 80% rF at \leq 30°C for > 12 h, > 60% rF at > 30°C for > 12 h), please contact us via www.testo.com/service-contact

Parameter	Unit	Unit Probes Physical Standard scal measuring range at 1013 hPa Reasuring rar		measuring range		er
Mixture dewpoint	$^{\circ}C_{tm}$		-20	+100	-20	+100
(H ₂ O ₂)	°F _{tm}		-4	+212	-4	+212
Degree of humidity	g/kg	all probes	0	13300	0	9500
	gr/lb	all probes	0	93000	0	66500
Enthalpy	kJ/kg		-40	99999	-40	8000
	BTU/lb		-18	43000	-18	3500
Psychrometer	$^{\circ}C_{tw}$		-40	100	-40	180
temperature	°F _{tw}		-58	210	-40	356
Water content	ppm (vol) H ₂ O		0	99999	0	99999
	% vol		0	100	0	100
Water vapour	hPa		0	1000	0	7000
partial pressure	inchH₂O		0	400	0	2800

4.2.9. Alarm handling

For upper and lower alarm limits, individual alarms as well as collective alarms can be specified. If the collective alarm function is activated, an alarm is triggered as soon as the alarm limit of an alarm is exceeded, if this alarm is assigned to the collective alarm.

The testo 6383 monitors limit values with the help of relays. If a reading is outside the limit values, a relay to be specified by the user is switched.

If the reading reverts to more than a specified hysteresis below or above the limit value, the alarm is cancelled.

In addition, information about the occurrence of error/status messages can be provided by means of a collective alarm relay, see Status, warning and error messages, page 66



If multiple alarm messages are activated at the same time, the last alarm is shown. If the alarm is cancelled again, the previous messages are no longer shown.

4.3. Commissioning

4.3.1. Mounting preparations



- Create a wall opening (approx. 120 mm x 220 mm) at the mounting location.
- 2. Hold 6383 in assembly position and mark the drill holes.
- Drill holes suitable for the screws to be used.
- 4. Connect 6383.

4.3.2. Connecting the instrument




WARNING

Electrical voltage

Danger of injury!

- > De-energize the mains connection before connecting the transmitter.
- Only have the transmitter wired and connected by authorized personnel with the voltage disconnected.


4.3.2.1. Overview of terminals

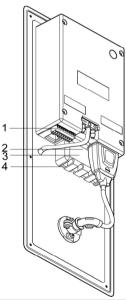

- Terminal strip for voltage supply and analog outputs
- 2 Relay terminal strip (option), below the relay cover
- 3 Relay cover (option)
- 4 Insulating trough for relay board (option), below the relay cover


The following description of the terminals refer to this overview and its numbering.

 4.3.2.2. Connecting voltage supply and analog outputs



Terminal strip for voltage supply and analog outputs, item (1) of overview of terminals

Wiring diagram for 4-wire system (0 to 20 mA/4 to 20 mA/0 to 1 V/0 to 5 V/0 to 10 V)

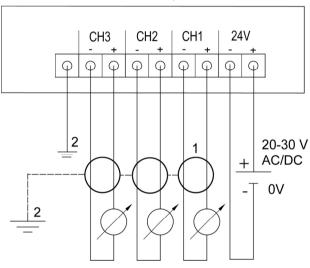

- $\begin{array}{cccc} 1 & 1 \text{ or } 3 \text{ channels,} \\ 0 \text{ to } 20 \text{ mA/4 to} \\ 20 \text{ mA max.} \\ \text{load per } 500 \, \Omega \\ 0 \text{ to } 1 \, \text{V / 0 to} \\ 5 \, \text{V / 0 to } 10 \, \text{V} \end{array}$
 - Functional earth

i

Requirement for the connecting cable of the supply:

- Shielded and insulated with cross-section of at least 0.25 sq. mm, maximum 1.5 sq. mm without wire end sleeves.
- The supply line must be secured against exceeding 0.5 A.
- An OFF switch must be installed in an easily accessible position close by and be marked as such.
- 1. Disconnect terminal strip for voltage supply and analog outputs.

- Strip the cable ends, clamp wire end ferrules on and screw down with voltage terminals/channel terminals.
- 3. Tie together each of the two adjacent cores using a cable tie.
- 4. Attach terminal strip for voltage supply and analog outputs.

4.3.2.3. Connecting the relay outputs

Only have the transmitter wired and connected by authorized personnel with the voltage disconnected.




Relay terminal strip, item (2) of overview of terminals

There is the option of twelve terminals for a total of four relays.

- 1. Remove relay cover.
- Disconnect relay terminal strip.
- 3. Strip cable ends and clamp on wire end ferrules.
- Connect relays according to chosen function (NC/NO) (see diagrams below; relay 1 is shown as an example of a connection).

Connection note

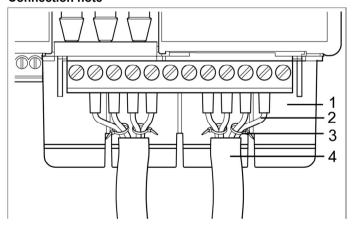


- i
- For the connection, a double-insulated mains cable (sheathed cable) with a cross-section of at least 1.5 mm² must be used.
- Cable connection (2) may not be routed in a loop within the relay trough (1).
- It is recommended that you always tie 2 adjacent cores

to one another using a cable tie (3).

The insulation of the cable must be fed at least 5 mm (4) into the relay tray up to the elevated part.


Use of relay as NC contact (NC = normally closed)

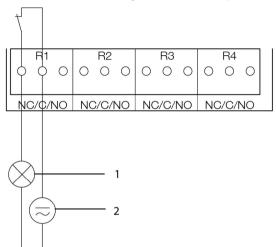

- Alarm/status light (example of installation)
- 2 250 V AC/DC, 3 A


The busy light (alarm/status light) is permanently on until the relay opens or the circuit is interrupted. This circuit can therefore be used to monitor the functionality of the alarm circuit, as a cable break, for instance, is indicated by the busy light going off.



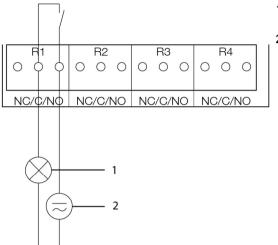

- 1 Alarm/status light (example of installation)
- 2 250 V AC/DC, 3 A

- The busy light (alarm/status light) only comes on when the relay is switched (closed). Monitoring the functionality of the alarm circuit is therefore not possible with this switching operation.
- 5. Insert relay terminal strip into socket.
- 6. Set on relay cover.

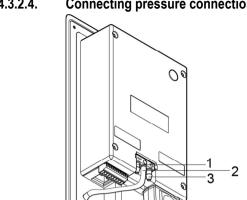


4.3.2.4. Connecting pressure connections

Illustration shows delivery status

Use of front pressure connection


- 1. Remove hose from hose holder (2) and connect to overpressure (3) or underpressure (1) connection.
- 2. Connect remaining pressure connection to (3) or underpressure potential (1) with additional hose.

 No use of front pressure connection




Connect pressure potentials to (3) or negative pressure connection (1) on the rear via hoses.

4.3.2.5. Closing the instrument

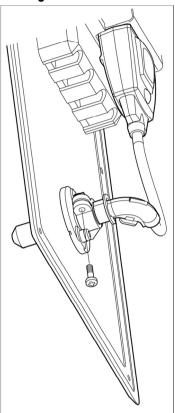

- 1. Connect probe.
 - · Version with integrated humidity probe:
 - 1. Insert probe into probe socket.
 - 2. Guide probe through opening of front plate.
 - 3. Tighten screw at opening.
 - · Version with external humidity probe:
 - > Insert probe into probe socket.
- 4. Slide Ethernet connector into Ethernet socket.

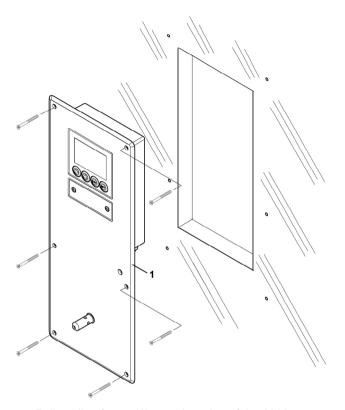

- 5. Pull sealing frame (1) over the edge of the 6383.
- Screw on 6383. Initially, only tighten the screws slightly. When all screws are in position, also align 6383 and tighten the screws.
- 7. Seal 6383 using a measure appropriate for the installation point (e.g. with a silicone strip).

4.3.3. Ethernet communication

4.3.3.1. Types of operation

The type of operation can be set via the operating menu:

Settings | Ethernet | Mode |

- Saveris Probe Mode: a corresponding testo 6383 becomes a Saveris participant
- XML Server Mode: a corresponding testo 6383 can be integrated into unlimited Ethernet systems

4.3.3.2. Mains connection

Connect the network cable to the transmitter.

The network cable must not be connected directly to the telephone network (ISDN).

4.3.3.3. testo as a Saveris component

Set IP address

- ✓ Network cable must be connected to the Ethernet interface.
- ✓ Service plug must be connected.

The IP address of the transmitter can set be either via the P2A software (transmitter accessory) or via the configuration menu of testo SaverisTM (testo SaverisTM Ethernet Assistent).

- Set the IP address with the P2A software (see Using the software, page 116) or with the testo SaverisTM Ethernet Assistent (see instruction manual).
- 2. Remove service plug.

Using Saveris

- > Start Saveris software (see instruction manual measurement data monitoring with testo Saveris).
- Ensure that the Saveris software is not already open, for example in multi-user operation in Windows® Vista. If several clients are installed in one network, ensure that when clients are operating simultaneously, they do not carry out simultaneous alterations to the configuration of the system.
- 1. [Start] | All Programs | Testo |
- Select Saveris Professional Client (full version). The selection is available if Saveris Professional Client is installed.
- Select Saveris Viewer (restricted functionality). The selection is available if the Saveris Viewer is installed.
- The program window Testo Saveris software is opened with the dialog Select project.



Should the Software not start, check in the service s 1 administration of the operating system whether the service testo tdassvcs is started, and if necessary, restart.

2. The option

- Select Only active projects when the data of a current project are to be opened.
- Select All projects when the data of a closed project are to be opened.
- 3. Select the project to be opened from the tree structure.
- Confirm with [OK].
- The program window Testo Saveris software is displayed in the foreground with the selected data set.

4.3.3.4. Integration into customer's Ethernet system

Precondition

i The user should be familiar with the structure of an XML document. Furthermore, enough knowledge should be available that this type of document can be downloaded and decoded via an Internet connection with the aid of a programming/script language.

Interface

The communication takes place according to the client/server principle, whereby the Ethernet module takes on the role of the server:

The XML interface will be approached via a URL. The URL consists of the IP address of the Ethernet module, the path for the XML document and, depending on the URL, with a clearly defined

parameter. If a parameter is missing or an incorrect value is transferred, the Ethernet module sends back a simple error message.

Example:

IP address = 254 169 100 100

URL for serialnumber.xml:

http://254.169.100.100/data/getserialnumber

If a parameter is required, a "?" is always in the first place after the URL, then the parameter is transferred to the common guery string form (name=value).

Example:

IP address = 254.169.100.100

URL for / identification.xml:

http://254.169.100.100/data/getidentification?param=0 (compare table xml codes)

After calling up the compound URL, if everything was correct, an XML document is returned. With faulty parameters a simple HTML answer comes that points out the reason that an XML answer could not be given.

If an XML document is to be loaded on the server, access is provided by means of a POST request

Example of an upload via the program wget:

IP address = 254.169.100.100

URL for / usersettings.xml:

Path details of the folder in which the wget program is located

Command

Path details of the folder in which the usersettings XML file is the next page)

IP address of the transmitter and required URL (see table on

H:/wget/wget-complete-stable

/wget --post-file=

C:/usersettings.xml

located

254.169.100.100/config/ setusersettings

The Ethernet module supports reading out of

- Readings
- Instrument type (testo 6383)
- Firmware date and version (testo 6383)
- Status and status messages (testo 6383)
- Alarm messages (testo 6383)
- Service hour counter (testo 6383 and probe)

as well as the reading and writing of the:

- Adjustment data (testo 6383)
- Configuration data of analog outputs (testo 6383)
- Configuration data of relays (testo 6383)
- User settings (testo 6383)

XML codes (download)

The table of xml-codes is available for download www.testo.com/download-center (requires registration).

URL	Description	Parameter	Answer (see Appendix)	
/data/getserialnumber	Read off serial number of connected transmitter		serialnumber.xml	
/data/getidentification	Read off type of connected transmitter/ probe	param=0 (for transmitter) param=1 (for probe)	identification.xml	
/data/getversion	Read off firmware version of connected transmitter		version.xml	
/data/getfirmwaredate	Read off firmware date of connected transmitter		firmwaredate.xml	
/data/getonlinevalue	Read off online values of connected transmitter		onlinevalue.xml	
/data/getviewchannels	Read off view channels of connected transmitter		viewchannels.xml	
/data/getstatus	Read off status of connected transmitter		status.xml	
/data/getlaststatusmessa ge	Read off last status message of connected transmitter		laststatusmessage.xml	
/config/gethourscount	Read off service hour counter of transmitter or probe		hourscount.xml	
/config/getusersettings	Read off settings of transmitter		usersettings.xml	
/config/getcalibration	Read off adjustment data of transmitter	param=0 (adjustment set 1) param=1 (adjustment set 2) param=2 (adjustment set 3)		
/config/getreldefinition	Read off relay information of transmitter	param=0 (relay 1) param=1 (relay 2) param=2 (relay 3) param=3 (relay 4)	reldefinition.xml	
/config/getheatertime	Read off sensor heating information		heatertime.xml	
/config/getoptions	Read off options of transmitter		options.xml	
/config/getcollectivealarm	Read off alarm messages of transmitter		collectivealarm.xml	

Upload XML documents

URL	Description	Parameter	Post	Answer (see Appendix)
/config/setusersettings	Perform settings of transmitter		usersettings.xml	usersettings.xml
/config/setcalibration	Set adjustment data of transmitter	param=0 (adjustment set 1) param=1 (adjustment set 2)	calibration.xml	calibration.xml
		param=2 (adjustment set 3)		
/config/setreldefinition	Set relay information of transmitter	param=0 (relay 1) param=1 (relay 2) param=2 (relay 3) param=3 (relay 4)	reldefinition.xml	reldefinition.xml
		param-3 (relay 4)		
/config/setheatertime	Set sensor heating information		heatertime.xml	heatertime.xml
/config/setoptions	Set options of transmitter		options.xml	options.xml
/action/setresettm	Not yet implemented		resettm.xml	

Description of the XML elements

General elements

XML tag	Description	Туре
measurement_value	Parent element. Contains the child elements value, unit, resolution	
value	Reading	Numerical, decimal number
unit	Unit	ASCII
number_values	Qty.	Numerical, whole number

Elements in calibration.xml

XML tag	Description	Туре
calibration_data	Base element. Contains the child elements unit, attenuation, cal_reserved, cal_offset, cal_scale.	
unit	See general elements	
attenuation	Damping (0 - 15)	Numerical, decimal number
cal_offset	Offset	Numerical, whole number
cal_scale	Parent element. Contains the child elements cal_minscale, cal_maxscale	

XML tag	Description	Туре
cal_minscale	Scaling value	Numerical, decimal number
cal_maxscale	Scaling value	Numerical, decimal number

Elements in collectivealarm.xml

XML tag	Description	Туре
colalarmtable	Base element. Contains the child elements alarm_numbers, alarm	
alarm_numbers	Number of alarm messages	Numerical, whole number
alarm	Parent element. Contains the child elements alarm_event, alarm_state	
alarm_event	Type of alarm	ASCII
alarm_state	Status of the alarm 0 = alarm inactive 1 = alarm active	Numerical, whole number

Elements in firmwaredate.xml

XML tag	Description	Туре
firmware_date	Base element. Contains the child elements year, month, day	
year	Year	Numerical, whole number
month	Month	Numerical, whole number
day	Day	Numerical, whole number

Elements in heatertime.xml

XML tag	Description	Туре
	Base element. Contains the child element heatertimeoff	
heatertimeoff	Time sensor heating off in min	Numerical, whole number

Elements in hourscount.xml

XML tag	Description	Туре
	Base element. Contains the child element hours	
hours	Service hour counter in h	Numerical, whole number

Elements in identification.xml

XML tag	Description	Туре
ident	Base element. Contains the child element device_id	
device_id	Transmitter type	Numerical, whole number

Elements in laststatusmessage.xml

XML tag	Description	Туре
mufmsg	Base element. Contains the child elements msg, sn, hours	
msg	Status message	ASCII
sn	Serial number	ASCII, 8 characters
hours	Service hour counter in h	Numerical, whole number

Elements in onlinevalue.xml

XML tag	Description	Туре
online_values	Base element. Contains the child elements number_values, measurement_value	
number_values	See general elements	
measurement_value	See general elements	

Elements in options.xml

XML tag	Description	Туре
options	Base element. Contains the child elements device_options, production_options	
device_options	See device_options description	Numerical, whole number
production_options	See production_options description	Numerical, whole number

Elements in reldefinition.xml

XML tag	Description	Туре
relay_data	Base element. Contains the child elements relay_channel, relay_number, relay_status, sw_point_character, sw_point_value, hysteresis_value	
relay_channel	Measurement channel linked to the relay	Numerical, whole number
relay_number	Relay number (0 - 2)	Numerical, whole number

XML tag	Description	Туре
relay_status	Status of relay 0 = off	Numerical, whole number
	1 = on	
sw_point_charact	Switch point: Switch point: 0 = low-limit monitoring 1 = high-limit monitoring	Numerical, whole number
sw_point_value	Switch point	Numerical, decimal number
hysteresis_value	Hysteresis	Numerical, decimal number

Elements in serialnumber.xml

XML tag	Description	Туре
	Base element. Contains the child element number	
number	Serial number	ASCII, 8 characters

Elements in status.xml

XML tag	Description	Туре
mufstatus	Base element. Contains the child elements statemsg, staterel, statecounter	
statemsg	Status message See statemsg description	Numerical, whole number
staterel	Status relay See staterel description	Numerical, whole number
statecounter	Counter	Numerical, whole number

Elements in usersettings.xml

XML tag	Description	Туре
usersettings	Base element. Contains the child elements (pressure)*, (abs_pressure_pa_process)*, (humidity_process)*, (temperature_c_process)*, (humidity_norm)*, (abs_pressure_pa)*, h2o2, setting_display, backlight, contrast, language, disp_msg, h2o2_prozess	
pressure	Absolute pressure	Numerical, decimal number
h2o2	H2O2 value	Numerical, decimal number

^{*} Child elements are optional

XML tag	Description	Туре
setting_display	Auto OFF background lighting 0 -> background lighting auto off	Numerical, whole number
	1 -> background lighting stays on	
backlight	Brightness of background lighting 0 to 9 (0 = off, 9 = max.)	Numerical, whole number
contrast	Display contrast 0 to 9 (0 = min., 9 = max.)	Numerical, whole number
language	Language 0 ->GERMAN 1 ->ENGLISH 2 ->FRENCH 3 ->SPANISH 4 ->ITALIAN 5 ->JAPANESE 6 ->SWEDISH	Numerical, whole number
disp_msg	Status messages display 0 = off 1 = on	Numerical, whole number
h2o2_prozess	H2O2 process 0 = via H2O2 water 1 = process with evaporated H2O2	Numerical, whole number
abs_pressure_pa_process,	Pressure process data, absolute pressure in Pa	Numerical, decimal number
humidity_process	Pressure process data, process humidity in % RH	Numerical, decimal number
temperature_c_process	Pressure process data, process temperature in °C	Numerical, decimal number
abs_pressure_pa	Humidity process data, absolute pressure in Pa	Numerical, decimal number

Elements in versions.xml

XML tag	Description	Туре
· · · -	Base element. Contains the child element version	
version	Firmware version:	ASCII, 6 characters

Elements in viewchannels.xml

XML tag	Description	Туре
view_channels	Base element. Contains the child elements number_values, view_channel	
number_values	See general elements	
view_channel	Parent element. Contains the child elements channel_info, measurement_value, meas_status	

XML tag	Description	Туре
channel_info	Parent element. Contains the child elements connector_info, channel_type	
measurement_value	See general elements	
meas_status	Parent element. Contains the child elements min, max, mean	
connector_info	Channel (transmitter/probe)	ASCII
channel_type	Parameter details	ASCII
min.	Minimum reading	Numerical, decimal number
max.	Maximum reading	Numerical, decimal number
mean	Mean value	Numerical, decimal number

production_options description

Content of production_options is a double word type number (32 bit). The individual hardware options are bit-coded here.

xxxx xxxx xxxx xxxx xxxx xxx1 2222 3334

- 1 0=2-wire
 - 1=4-wire
- 2 free
- 3 0=4 to 20 mA
 - 1=0 to 20 mA
 - 2=0 to 1 V
 - 3=0 to 5 V
 - 4=0 to 10 V
- 4 0=1 analog output
 - 1=3 analog outputs

device_options description

Content of device_options is a double word type number (32 bit). The individual instrument options are bit-coded here.

xxxx xxxx xxxx xxxx xxxx xxxx 1222 2345

- 1 0=probe is invalid1=probe is valid
- 2 free
- 3 free
- 4 0=no relay present1=relay present

XXXX XXXX XXXX XXXX XXXX 1222 2345

5 0=no display1=display present

statemsg description

Content of statemsg is a double word type number (32 bit). The individual status messages are bit-coded here.

If statemsg = 0 there are no new messages.

If statemsg != 0

xxxx xxxx xxxx xxxx xxxx xxxx 1234 5678

- 1 free
- 2 1=probe information
- 3 1= probe warning
- 4 1=probe error
- 5 free
- 6 1=transmitter information
- 7 1=transmitter warning
- 8 1=transmitter error

staterel description

Content of staterel is a double word type number (32 bit). The individual relay states are bit-coded here.

XXXX XXXX XXXX XXXX XXXX XXXX 1234

- 1 0=relay 4 is not set 1=relay 4 is set
- 2 0= relay 3 is not set 1=relay 3 is set
- 3 0=relay 2 is not set 1=relay 2 is set
- 4 0=relay 1 is not set 1=relay 1 is set

More information can be found in the download area at www.testo.com.

4.3.3.5. Adjusting the instrument

The testo adjusting concept allows the entire signal chain from the sensor signal (probe) and the digital signal (within the transmitter) through to the analog signal (transmitter output signal) to be adjusted (see diagram).

1-point adjustment 2-point adjustment 0000 Adjustment via Adjustment 11.3 % RH/ 75.3 % RH and 20 % RH/ testo 400/650 80 % RH via handheld instrument with adjustment User menu adapter P2A software P2A software User menu n-point adjustment Analog adjustment 0000 0000

Adjustment using a precise multimeter and transmission of analog reference value in

- User menu or
- P2A software


Adjustment using a precise pressure sensor and transmission of analog reference value in

- User menu or
- P2A software

Either the 1-point adjustment or 2-point adjustment is suitable for adjusting the sensor signal - digital signal chain.

The testo 6383 transmitter has digital probes whose adjustment information is stored in the probes' internal memory. Both 1-point and 2-point adjustments can thus be carried out on another testo 6383 (e.g. in the calibration laboratory).


4.3.3.6. Overview: Adjustment keys and test contacts

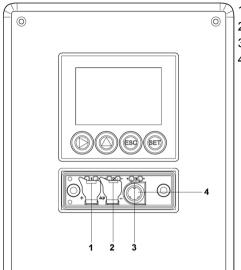

- Contact ch. 1
- 2. Contact ch. 2
- 3. Contact ch. 3
- 4. Service interface

4.3.3.7. 1-point adjustment (offset - humidity/temperature)

In the 1-point adjustment, the reading at the working point is raised to the reference value so that there is no longer any deviation in the working point. The reference condition can be measured using a precise handheld instrument (e.g. testo 400/650 with precision humidity probe) or be created in an air conditioning cabinet.

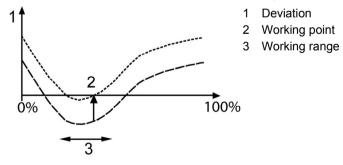

The advantage of the 1-point adjustment is the good measuring result in the working range. But the further away the measurement is from the working point, the greater the deviation can become. The 1-point adjustment should therefore only be used for a

relatively narrow measuring range (working range), e.g. clean room applications, air conditioning applications for storage and similar.


The 1-point adjustment can be performed

- via the user menu see Editing Main Menu Adjust, page 62or
- via the P2A software (see Band 2, 1-point adjustment page 134) or
- directly by means of a Testo handheld instrument (testo 400/650) (see description of how to proceed below).

Please note that the 1-point adjustment is generally performed on the basis of the % RH and °C/°F parameters.

Adjusting testo 6383 using testo handheld instrument

√ The service flap is open, a testo 400/650 handheld instrument with a precision humidity probe is ready.

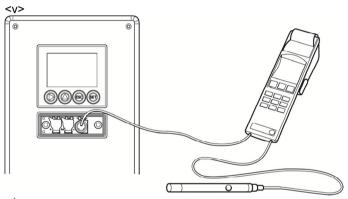

- </y>
- Connect testo handheld instrument 400/650 (1) with connected humidity reference probe (3) (order no. reference set 0699 3656/20) to the service interface (5) of the testo <v>T Produktname MUF</v> via the adjustment adapter (2) (connected to probe socket 1 of the handheld instrument).
- Expose the humidity probe (4) of the testo <v>T Produktname MUF</v> and the reference probe (3) to the same reference conditions (e.g. in the humidity generator) and allow climatic conditions to equalize.
- 3. Switch on the testo 400/650. The two-part display of the handheld instrument will show the values of the transmitter on the left, and the values of the reference probe on the right. The humidity and temperature values are adjusted to the reference probe using the Probe > Probe Adjustment menu item on the


testo 400/650. The 1-point adjustment is performed for both the humidity and the temperature.

- 4. Disconnect the adjustment adapter (2) from the service interface (5).
- 5. Close the service flap.
- Adjustment with the standard testo adjustment salt pots is not suitable for the testo 6614 (heated for high-humidity applications) and testo 6615 (trace humidity) probes.

 The reference conditions should be generated in a humidity generator to adjust these probes. In addition, these probes can also be adjusted at a third adjustment point by Testo Service.
 - testo 6614: third adjustment point at 90 % RH
 - testo 6615: third adjustment point at -40 °Ctd/-40 °Ftd

4.3.3.8. 2-point adjustment (humidity/temperature)

With the 2-point adjustment, the parameter is adjusted to the reference value at the two standard adjustment points 11.3 % RH and 75.3 % RH or 20 % RH and 80 % RH. The reference conditions are created either by using testo adjustment salt pots (order no. 0554 0660, only for adjustment points 20 %RH and 80 %RH) or in the humidity generator.

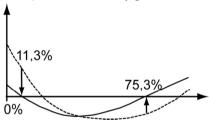


In the 2-point adjustment, the deviations between the reading and the nominal value are minimized across the entire measuring range. The 2-point adjustment is therefore recommended for large working ranges.

The 2-point adjustment can be performed

- via P2A software (only for the adjustment points 11.3 %RH and 75.3 %RH) or
- via the operating menu.
 - A previous 1-point adjustment is undone during a 2-point adjustment.

4.3.3.9. Analog output adjustment

The purpose of adjusting the analog outputs is to adjust the signal chain from the digital signal (within the transmitter) to the analog outputs. The signal type that was appointed for the transmitter is adjusted respectively for each channel (e.g. 4 to 20 mA or 0 to 1 V, etc.).

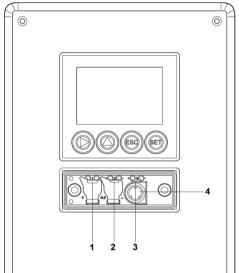

- Contact ch. 1
- 2. Contact ch. 2
- 3. Contact ch. 3
- 4. Service interface


Adjusting analog outputs 1, 2 and 3 (optional)

- \checkmark With testo 6383 with current output: Load of max. 500 Ω is connected to channel that is to be adjusted see Connecting voltage supply and analog outputs, page **22**.
- ✓ A precise multimeter (minimum requirement: resolution 6.5 digits, at least 5-times more accurate than the 6383) is available.
- If only a simple multimeter is available, the analog outputs must not be adjusted.
- ✓ The service cover is open.
- Connect the inputs of the multimeter with the contacts (1) and (2) for channel 1 or with contacts (3) and (4) for channel 2, (5) and (6) for channel 3.

- Transfer the reference analog value measured with the multimeter into the P2A software (see volume 2, Adjusting the analog output, page 137) or enter it via the user menu (see Editing Main Menu Adjust, page 62).
- 3. Disconnect connections between the multimeter and the contacts of the testo 6383 and close the service cover.

4.3.3.10. n-point adjustment (pressure)


With an n-point adjustment, the parameters at the 3-6 measurement points are adjusted to the reference value. The reference conditions are obtained by using a precise pressure sensor that should be 5-times more accurate than the transmitter.

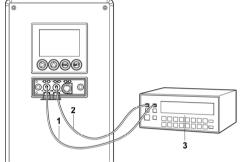

- 1 Positive pressure connection
- 2. Negative pressure connection
- 3. Pressure sensor

- The number of measuring points is set to 3 by the factory and can only be changed using the P2A software (see **n-point adjustment** page 136).
- The n-point adjustment must always be carried out to its full extent and in good time at all selected measurement points.
- ✓ A precise pressure sensor (5-times more accurate than the transmitter, e.g. DPC precision pressure sensor from testo industrial services) is available.
- Connect the positive output of the pressure sensor (3) to the
 positive pressure connection of the transmitter (1) and the
 negative output of the pressure sensor (3) to the negative
 pressure connection of the transmitter (2).
- Transfer the reference pressure value created with the pressure sensor into the P2A software (see volume 2, n-point adjustment, page 136) or enter it via the user menu (see Editing Main Menu Adjust, page 62).
- Repeat step 2 for all of the measuring points.
- 4. Disconnect connections between the pressure sensor and the pressure connections of the testo 6383.

4.3.3.11. High-humidity adjustment for testo 6614

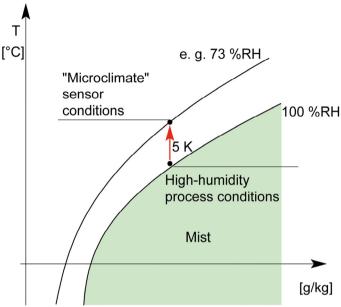

With the testo 6614, the rear of the Testo humidity sensor is heated, creating a microclimate around the sensor (within the filter) that is constantly 5 K warmer than the actual process conditions. As can be seen in the Mollier diagram, this reduces the relative humidity at the sensor from around 100 % RH to a lower value, e.g. 73 % RH. In this range, the reaction time of the sensor is noticeably shorter than in the condensation range and the risk of the sensor corroding is also reduced. Using the separate temperature probe, the testo 6383 transmitter compensates the microclimate conditions and displays the process readings.

1


The reference conditions (11.3 % RH and 75.3 % RH or 20 %RH and 80 %RH) for the 2-point adjustment of the testo 6614 should be generated in a humidity generator, as humidity adjustment sets cannot be used due to the heat generated.

The adjustment can also be carried out at a third adjustment point (90 % RH) by Testo Service so that optimum accuracy is also achieved in the high humidity ranges.

4.3.3.12. Self adjustment of testo 6615 trace humidity probe

Conventional trace humidity probes show a steep rise in measuring uncertainty at low humidities. In the testo 6615 trace humidity probe, these measuring uncertainties are corrected by means of an automatic self-adjustment process. This means that extremely accurate measuring results are also attained to -60 °Ctd.

To this end, a temperature sensor is fitted on the back of the testo 6615 which is used as a heater. A humidity and temperature value pair is taken in both the unheated and heated state. The deviation of the probe obtained from these pairs of values is automatically corrected.

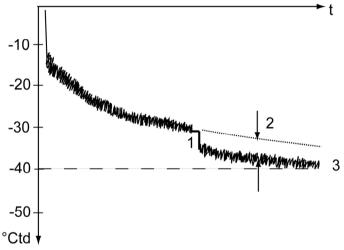


The graph shows the effect of the self-adjustment, e.g. during the Init. phase.

- 1 Self-adjustment
- 2 Correction of measurement value
- 3 Process dew point temperature

For the effectiveness of the self-adjustment the following prerequisites are decisive over the duration of the self-adjustment.

- The process temperature should not vary by more than 0.5K
- The dew point temperature should remain stable, as far as possible
- The process pressure should not vary excessively
- If these prerequisites cannot be fulfilled, the values obtained during the last successful self-adjustment will be maintained.

All adjustment processes are saved in the history of the transmitter, see **Transmitter history** page 139.

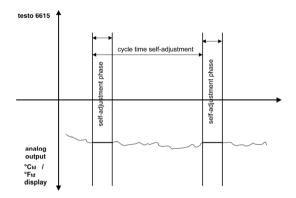



- Deactivating the adjustment function of the testo 6615 will reduce measuring accuracy and should therefore be restricted to the shortest possible length of time.
- During the heating phase, the relay and analog outputs, the display value and output value are "frozen", see diagram above. Self-adjustment active is shown in the display until it has finished. The factory setting for selfadjustment time (incl. heating time, calculation time, cooling time) requires 30 minutes daily. The cycle time can be edited via the operating menu or the P2A software.
- In the factory setting, a third adjustment point (-40 °Ctd) is approached for the testo 6615 in addition to the 2-point adjustment. This special adjustment can be performed again by your Testo Service team if necessary.

4.4. Operation

4.4.1. Relationship between user menu and mini-DIN socket is active

The testo 6383 can be parameterized using either the user menu or the P2A software (see volume 2, Parameterizing, adjusting and analyzing software (P2A software) page 112).



The testo 6383 transmitter can only be operated via the display and keypad if the display option is available.

If the testo 6383 is connected to the P2A software, the user menu is blocked for the duration of the communication. The message Service plug is shown in the display of the testo 6383. As soon as the P2A software is disconnected, the user menu is accessible again.

4.4.2. Password protection


The user menu can be protected with a four-digit numerical code (see Editing Main Menu Settings, page **56**) so that access to the user menu is denied to unauthorized persons not familiar with this numerical code.

If the password protection is not to be used, the numerical code "0000" must be entered. This is also the status upon delivery.

4.4.3. Structure of user menu

At the main menu level, the user menu comprises the following:

- Main Menu Channel 1
- Main menu of channel 2 (if this option is available)
- Main menu of channel 3 (if this option is available)
- Main Menu Alarm
- Main Menu Settings
- Main Menu Analysis
- Main Menu Messages
- Main Menu Ident
- Main Menu Adjust
- Main Menu Reset

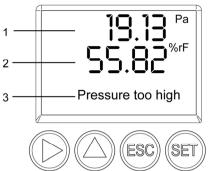



- 1 Channel 1 display
- 2 Channel 2 display
 - 3 Channel 3 display or for messages


Four keys enable the user to navigate/scroll through the menus and enter/amend values and settings:

Key	Function/description
SET	 In Measuring Mode: changes to parameterization In Parameterizing Mode: confirms a selection or setting
ESC	Leaves a menu (without modifying any settings)
>	 Selecting: scrolls through menus (downwards) or selectable alternatives Editing: changes to next digit (to the right)
•	 Selecting: scrolls through menus (upwards) or selectable alternatives Editing: increases the value of the current digit by 1

4.4.4. Overview of the testo 6383 user menu

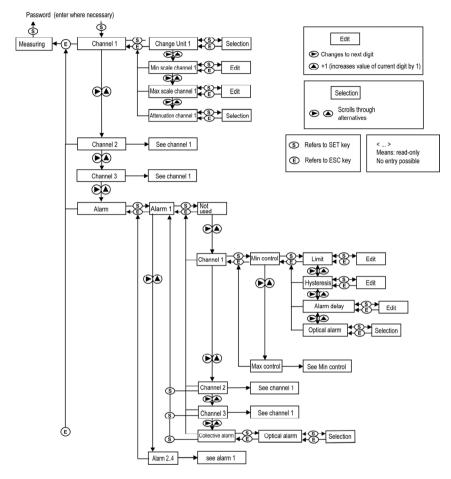

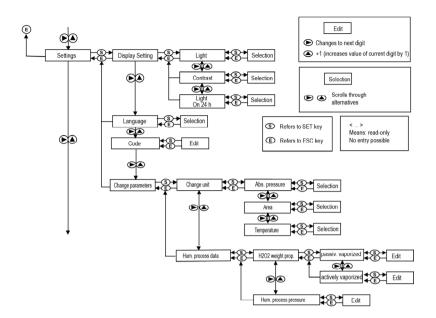

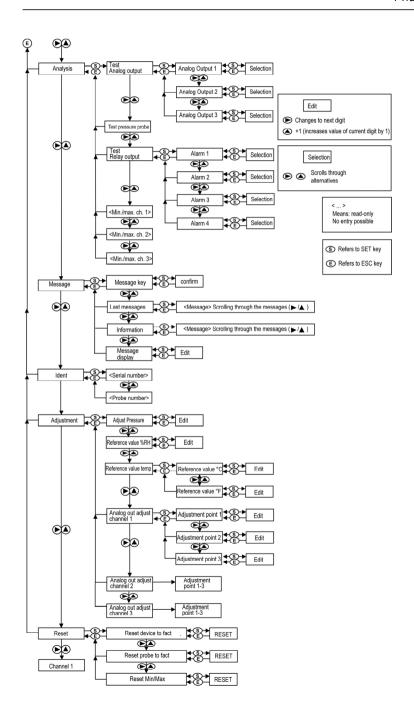

4.4.5. The individual main menus

4.4.5.1. Editing main menu of channel 1

An overview is given in Overview of the testo 6383 user menu, page 51).

You can perform basic settings for channel 1.

 In the Measuring Mode press SET, select Main Menu Channel 1 with ▶ or ▲ and confirm selection with SET.
 One of the following parameters can now be selected using ▶

or ▲, after which the selection must be confirmed with SET:

Channel 1 Unit

The parameter for this channel is selected.

Edit/select parameter with ▶ or ▲, confirm with SET or abort entry with ESC.

Scale minimum for channel 1:

The lower scale limit is edited; Unit as selected above.

Editing the value: Scroll one digit to the right using ▶ and increase value of digit by 1 using ▲. Confirm with SET or abort entry with ESC.

Scale maximum for channel 1

The upper scale limit is edited;

Unit as selected above.

Editing the value: Scroll one digit to the right using ▶ and increase value of digit by 1 using ▲. Confirm with SET or abort entry with ESC.

Signal delay ("Attenuation") for channel 1

The analog signal can be delayed ("Attenuation"); a time constant is selected for this (1 = no delay; 2-15 = delay in seconds)

Edit/select parameter with ▶ or ▲, confirm with SET or abort entry with ESC.

 Continue to the main menu with ▶ or ▲ or return to Measuring Mode with ESC.

4.4.5.2. Editing Main Menu Channel 2 (if this option is available) See channel 1.

4.4.5.3. Editing Main Menu Channel 3 (if this option is available) See channel 1.

4.4.5.4. Editing Main Menu Alarm

With the alarm, the relays, available as options, are programmed. In addition, the alarm statuses are shown on the display (top right) (even without relays).

You can choose whether the alarm is to be used to monitor limit values or as a collective alarm. If an alarm is to be used to monitor limit values, you can choose between monitoring the minimum or maximum value and set a limit value and hysteresis for each alarm.

In addition, every alarm can be linked to a clearly visible visual alarm (display background lighting and the corresponding measurement value flash when limit values are violated).

An alarm delay between 0 and 3600 seconds can still be assigned to every alarm used for limit value monitoring so that both the corresponding relay effect and the visual alarm are delayed. If the alarm status goes out within the set alarm delay time, neither the visual alarm nor a relay connection is triggered.

With an alarm status present, the visual alarm and all relay outputs can be reset by means of acknowledgement with any button. The triggering of a new alarm cannot be enabled until after the alarm status goes out.

- In the Measuring Mode press SET, select Main Menu Alarm with ▶ or ▲ and confirm selection with SET.
- Four alarms can be parameterized.
- Select Alarm x with ▶ or ▲ and confirm selection with SET.

Using alarm to monitor limit values

NO contact

Monitoring minimum

Hysteresis

On

Off

Limit value

Monitoring maximum Hysteresis On Off Limit value

NC contact

Monitoring minimum

Hysteresis

On



 
Monitoring maximum
Hysteresis
On
Off

Limit value

- Select Channel x (e.g. "Channel 1") with ▶ or ▲ and confirm selection with SET.
- Select Max control or Min control with ▶ or ▲ (see graphic).
- Press SET and edit Limit value as well as Hysteresis: Scroll one digit to the right using ▶ and increase value of digit by 1 using ▲. Confirm with SET or abort entry with ESC.
- Select Visual alarm with ▶ or ▲. Select YES or NO with ▶ or ▲. Confirm with SET or abort entry with ESC.
- Press SET and edit Alarm delay: Scroll one digit to the right using ▶ and increase value of digit by 1 using ▲ (0 to 3600 seconds possible). Confirm with SET or abort entry with ESC.
- 8. Return to Channel x with ESC.
- Return to Alarm x with ESC.
- 10. Change to the other relays using ▶ or ▲ and perform settings in the same way.

Using alarm as collective alarm or not using it at all

If an alarm is assigned to the collective alarm, the relay is switched and a visual alarm can be issued via the display as soon as (at least) one of the warning or error messages of the testo 6383 transmitter (or the connected testo 6610 probe) becomes active.



- ✓ Alarm is selected (see previous steps 1 and 2).
- Use ▶ or ▲ to determine whether Alarm x should be used as a Collective alarm or not used. Confirm selection with SET.
- If collective alarm is selected: Select Visual alarm with ▶ or ▲. Select YES or NO with ▶ or ▲. Confirm with SET and return to Alarm x.
- Change to another alarm using ▶ or ▲ and perform settings in the same way.
- Return to Main Menu Alarm with ESC.
- Continue to Main Menu Settings with ▶ or ▲ or return to Measuring Mode with ESC.

4.4.5.5. Editing Main Menu Settings

You can edit instrument settings and other settings.

In Measuring Mode, press SET, select Main Menu Settings using ▶ or ▲ and confirm selection with SET. You can edit settings for:

- Display
- Language
- Code
- Units
 - Absolute pressure
 - Area
 - Temperature
- Humidity process data
 - H2O2 percentage by weight
 - Humidity process pressure

Editing display settings

You can set the brightness and contrast of the display.

- Select Display Settings with ▶ or ▲ and confirm selection with SET.
- Select Backlight or Contrast with ▶ or ▲ and confirm selection with SET.

One of the following parameters can now be selected using ▶ or ▲, after which the selection must be confirmed with SET:

Backlight

The display illumination is changed.

Edit/select parameter with ▶ or ▲, confirm with SET or cancel entry with ESC (the effect of the change in parameter can be seen during input).

Contrast

The brightness difference between the display background and the displayed values is changed.

Edit/select parameter with ▶ or ▲, confirm with SET or cancel entry with ESC (the effect of the change in parameter can be seen during input).

Backlight 24h on

Select On or Off using ▶ or ▲ and confirm with SET.

Off: The display light switches off automatically if no button was pressed for 10 seconds.

On: The display light is activated

Return to Display Settings with ESC and use ➤ or ▲ to continue to Language.

Selecting language

You can select the language for the plain text line in the display.

> Press SET, select required language with ▶ or ▲, confirm selection with SET and return to Language.



Only choose a language that you can understand well.

Editing code settings

You can set the access code (password).



If a code other than "0000" (factory setting) is set, the transmitter can only be operated once this code has been entered via the menu.

- Select Code with ▶ or ▲ and confirm selection with SET.
- Scroll one digit to the right using ▶ and increase value of digit by 1 using ▲. Confirm with SET or abort entry with ESC.
- Return to Code with ESC and use ➤ or ▲ to continue to Change parameters.

Select unit (Change unit)

This setting affects the displayed unit of all readings.

- Press SET, select Change parameters with ▶ or ▲, confirm selection with SET or cancel with ESC.
- Select Change unit with ▶ or ▲, confirm selection with SET or cancel with ESC.
- Select the required variable (absolute pressure/area/temperature) with ▶ or ▲, confirm selection with SET or cancel with ESC.
- Select the required unit with ▶ or ▲, confirm selection with SET or cancel with ESC.
- 5 Return to Change unit with ESC.
- Return to Change parameters with ESC.
- Return to Main Menu Settings with ESC.

Editing Humidity process data

This menu is only used to parameterize humidity measurements in H_2O_2 atmospheres (e.g. in sterilization processes) and determines whether °Ctm or °Ftm is the output parameter.

- Select Humidity process data with ▶ or ▲ and confirm selection with SET.
- Select H202 weight prop. with ▶ or ▲, confirm selection with SET or cancel with ESC.

The selection H_2O_2 passively vaporized or H_2O_2 actively vaporized in the submenu describes whether H_2O_2 is generated by means of evaporation or is actively vaporized in the process.

- Select H₂O₂ passively vaporized or H₂O₂ actively vaporized with ▶ or ▲ and confirm with SET.
- Edit proportion by weight of the H₂O₂ in % (% H₂O₂ proportion by weight in the liquid initial solution): Scroll one digit to the right using ▶ and increase value of digit by 1 using ▲. Confirm with SET or abort entry with ESC.
- Return to H202 weight prop. with ESC and use ➤ or ▲ to continue to Humidity process pressure.
- Select Humidity process pressure with ▶ or ▲ and confirm selection with SET.
- Edit humidity process pressure: Scroll one digit to the right using ▶ and increase value of digit by 1 using ▲. Confirm with SET or abort entry with ESC.
- 8. Return to Change parameters with ESC.
- 9. Return to Main Menu Settings with ESC.

Setting Ethernet

Further information is available under Ethernet communication, page 28..

4.4.5.6. Editing Main Menu Analysis


You can test the functionality of analog and relay outputs. In addition, you can read off the minimum and maximum values (since the last voltage supply or reset of the min./max. values).

Testing functionality of analog outputs

- This function affects the analog outputs directly, not only the test contacts.
- In the Measuring Mode press SET, select main menu Analysis with ▶ or ▲ and confirm selection with SET.
- Test Analog Output is shown.
- Press SET and choose between Analog output 1, 2, 3 with ▶ or ▲.
- Press SET, scroll one digit to the right using ▶ and increase value of digit by 1 using ▲. Any analog output value can be predefined, e.g. for an analog output of 4 to 20 mA, the value "6.0 mA". Confirm with SET or abort entry with ESC.

4. Accept setting by pressing SET and test with multimeter (minimum requirement: resolution 6.5 digits, at least 2-times more accurate than the 6383) as follows:

Analog output 1, 2 or 3: Via test contacts under service cover, see diagram.

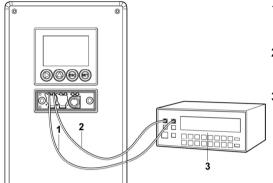

- Positive test contact channel 1
- 2 Negative test contact channel 1
- 3 Multimeter

 Return to Test Analog Output with ESC and use ▶ or ▲ to continue to Test Relay Output.

Testing functionality of the pressure sensor (Test pressure sensor)



This function is only required to calibrate the pressure sensor

Testing functionality of relay outputs

- 1. Press SET and choose between Alarm 1, 2, 3, 4 with ▶ or ▲.
- Press SET.

The relay can now be tested. You can choose between OFF and ON using ▶ or ▲. If ON is chosen, the NO contact is closed, the NC contact opened. If OFF is chosen, the NC contact is closed, the NO contact opened.

- To test, route a measuring cable from the relay terminals (see Connecting the relay outputs, page 23) out of the transmitter to a multimeter (resistance measurement) or continuity tester.
- Return to Test Relay Output with SET (starts relay test) or ESC (exits the menu without relay test).


Reading off min./max. values of channels

To reset the max./min. values, see Editing Reset main menu, page 65.

- Read off the min./max. values of the three channels in succession with ▶ or ▲ and return to the Main Menu Analysis with ESC.
- Continue to Main Menu Message with ▶ or ▲ or return to Measuring Mode with ESC.

4.4.5.7. Editing Message main menu

Messages can be confirmed/acknowledged, the last messages can be called up and the display of the messages can be switched on or off.

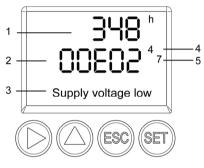


- 1 Operating hours at the time of message
 - Message code (see Status, warning and error messages, page 66).
- 3 Message text
- 4 Message number (example: "4/7" refers to the fourth of seven messages)
- 5 Number of messages present (example: "4/7" refers to the fourth of seven messages)
- Using the P2A software (see volume 2, Parameterizing, adjusting and analyzing software (P2A software), page 112) you can predefine whether messages are to be shown in the display.
- In the Measuring Mode press SET, select Main Menu Message with ▶ or ▲ and confirm selection with SET.
- Confirm Confirm message using SET.
- 3. Select Last messages with ▶ or ▲ and confirm with SET.
- Scroll between the warning and error messages recorded so far using ▶ or ▲ and return to Last messages using ESC.
- Select Information with ▶ or ▲ and confirm with SET.
- 7. Continue to Display of message with ▶ or ▲.

ON: Measurements are shown on the display in Measuring Mode.

OFF: No messages shown on display.

- 8. Select ON or OFF with ▶ or ▲ and confirm selection with SET.
- 9. Return to Main Menu Message with ESC.
- Continue to Main Menu Ident with ▶ or ▲ or return to Measuring Mode with ESC.
- An overview of the messages can be found in Status, warning and error messages, page 66

4.4.5.8. Calling up Main Menu Ident

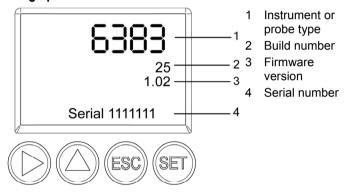

The serial numbers of the transmitter and probe can be read off.

- In the Measuring Mode press SET, select Main Menu Ident with ▶ or ▲ and confirm selection with SET.
- The type, firmware version, build number and serial number of the transmitter are displayed.
- This information is required when servicing.
- Return to Main Menu Ident with ESC or read off the type, firmware release, build number and serial number of the probe with ▶ or ▲ and then return to Main Menu Ident with ▶ or ▲.
- Continue to Main Menu Adjust with ▶ or ▲ or return to Measuring Mode with ESC.

4.4.5.9. Editing Main Menu Adjust

A reference value can be entered for both relative humidity (RH) and temperature (°C/°F) for the 1-point adjustment. Please refer to the description in 1-point adjustment (offset - humidity/temperature), page 41.

The 2-point adjustment for the adjustment points 11.3 %RH/75.3 %RH and 20 %RH/80 %RH is carried out via operation menu.

Reference values for pressure can be entered for the n-point adjustment. Please refer to the description in n-point adjustment (pressure), page 45.

In addition, the analog outputs can be adjusted. For instructions on how to do this Also pay attention to Analog output adjustment, page **44**. see Analog output adjustment, page **44**.

Enter reference value for 1-point adjustment

Please also refer to 1-point adjustment (offset - humidity/temperature), page 41.

- In the Measuring Mode press SET, select main menu Adjust with ▶ or ▲ and confirm selection with SET.
- Reference value % RH is displayed.
- Press SET, edit value: Scroll one digit to the right using ▶ and increase value of digit by 1 using ▲. Confirm with SET or abort entry with ESC.
- Continue to Reference value temp with ▶ or ▲.
- Press SET, Reference value °C or Reference value °F is displayed.
- Press SET, edit value: Scroll one digit to the right using ▶ and increase value of digit by 1 using ▲. Confirm with SET or abort entry with ESC.
- Continue to Analog Adj. Ch. 1 with ▶ or ▲.
- Continue with the adjustment of the analog outputs (see below, step 2) or press ESC to return to main menu Adjust.
- Continue to main menu Reset with ▶ or ▲ or return to Measuring Mode with ESC.

Carrying out a 2-point adjustment

- In measurement mode, press SET, select Main Menu Adjust with ▶ or ▲ and confirm selection with SET.
- Continue to 2 point adj 11/75% or 2 point adj 20/80% with ▶ or ▲.
- Press SET.
- Continue to Adjust Point 11%/Adjust Point 20% or Adjust Point 75%/Adjust Point 80% with ▶ or ▲.
- Confirm query with SET.
- In the display, 2 point adj 11/75% or 2 point adj 20/80%, 1-point adjustment, Probe reset appear one after the other.
- After a probe reset, the adapted values appear.

Start self-adjustment



The menu item self-adjustment is only visible when a testo 6615 probe is connected.

- In the Measuring Mode press SET, select Main Menu Adjust with ▶ or ▲ and confirm selection with SET.
- Select Self-adjust with ▶ or ▲ and confirm with SET.
- 3. Select Start Self-adjust with ▶ or ▲ and confirm with SET.
- Self-adjustment starts, the display value and the output value are "frozen".
- Continue to Cycle time with ► or ▲ (see below, step 2) or press ESC to return to Main Menu Adjust.

Setting cycle time of the self-adjustment

The time span to the next self-adjustment is shown in the status line of the display approx. every 5 seconds.

- In the Measuring Mode press SET, select Main Menu Adjust with ▶ or ▲ and confirm selection with SET.
- 2. Select Self-adjust with ▶ or ▲ and confirm with SET.
- Select Cycle time with ▶ or ▲ and confirm with SET.
- Select the desired value (48h / 24 h / 12 h / 6 h / 1 h / off) with
 or ▲, confirm with SET and return to Cycle time.
- Continue to Error signal on/off with ▶ or ▲ (see below, step 3) or press ESC to return to Main Menu Adjust.

Performing analog adjustment

- In the Measuring Mode press SET, select main menu Adjust with ▶ or ▲ and confirm selection with SET.
- Each channel is adjusted at three points in the analog range (at 10 %; 50 %; 90°% of the analog scale).
- Select Analog Adj. Ch. 1 with ▶ or ▲ and confirm with SET.
- Use ▶ or ▲ to select Adj. Point 1.
- Press SET. Read off multimeter display (e.g. 5601 mA) and enter this value in the user menu. Do this by scrolling one digit to the right using ▶ and increasing the value of digit by 1 using ▲. Confirm with SET or abort entry with ESC.
- Use ▶ or ▲ to select Adj. Point 2.
- Press SET. Read off multimeter display (e.g. 12,001 mA) and enter this value in the user menu. Do this by scrolling one digit to the right using ▶ and increasing the value of digit by 1 using ▲. Confirm with SET or abort entry with ESC.
- 7. Use ▶ or ▲ to select Adj. Point 3.

- Press SET. Read off multimeter display (e.g. 18,401 mA) and enter this value in the user menu. Do this by scrolling one digit to the right using ▲ and increasing the value of digit by 1 using ▶. Confirm with SET or abort entry with ESC.
- With ▶ or ▲ continue to Analog Adj. Ch. 2or 3 (repeat steps 3 to 8).
- 10. Return to main menu Adjust with ESC.
- Continue to main menu Reset with ▶ or ▲ or return to Measuring Mode with ESC.

Performing the pressure adjustment

Please refer to n-point adjustment (pressure), page 45

- In the Measuring Mode press SET, select main menu Adjust with ▶ or ▲ and confirm selection with SET.
- The pressure adjustment can be performed at 3 to 6 adjustment points.
- 2. Select Adjust Pressure with ▶ or ▲ and confirm with SET.
- 3. Use ▶ or ▲ to select Adj. Point 1.
- Press SET. Read off pressure sensor display (e.g. 30.1 Pa) and enter this value in the user menu. Do this by scrolling one digit to the right using ▶ and increasing the value of digit by 1 using ▶. Confirm with SET or abort entry with ESC.
- 5. Repeat steps 1 to 4 for adjustment points 2 to 6.
- 6. Return to main menu Adjust with ESC.
- Continue to main menu Reset with ▶ or ▲ or return to Measuring Mode with ESC.

4.4.5.10. Editing Reset main menu

You can reset the factory settings for the following:

- Instrument
- Sensor/probe
- Min./max. values
- Resetting to the factory settings means resetting to the order specification, i.e. the specific condition at the time of supply to the customer.
- In the Measuring Mode press SET, select Main Menu Reset with ▶ or ▲ and confirm selection with SET.
- Reset Device to factory settings is displayed.
- Select the setting to be reset using ▶ or ▲ and confirm selection with SET.
- Reset Completed is displayed.

- Return to the reset setting with ESC or SET and return to Main Menu Reset with ESC.
- Continue to Main Menu Channel 1 with ▶ or ▲ or return to Measuring Mode with ESC.

4.5. Status, warning and error messages

To achieve optimum operational reliability (machine availability), the transmitter shows the following via the user menu or the P2A software

- Status messages
- Warning messages
- Error messages

The status and warning messages for the respective testo 6610 probes connected to the transmitter can be evaluated via the P2A software.

All messages are stored in the transmitter with an operating hours stamp. Use the user menu (see Editing Message main menu, page 61) or the P2A software (see volume 2, Transmitter history, page 139) to view the message history.

In the transmitter, the last 60 status messages and the last 120 error and warning messages are stored in a ring memory. There is no limit in the P2A software.

4.5.1. Status messages

Status messages show the current operating status of the testo 6383.

Message	Display	Description
02506	Sensor initialization	Message appears while the transmitter is starting up. If the message disappears, the transmitter is ready for operation.
01D19	Service plug	The Mini-DIN socket is connected to: the USB adapter for P2A software, the adjustment adapter or the service plug (is not recorded/no number)
00300	New limit value	The limit value has been changed or shifted
00301	Scaling changed	The scaling has been changed

Message	Display	Description
00500	Transmitter reset	The transmitter was reset to the factory settings and is restarted.
0052F	Reset Min/Max	Resets all saved Min/Max values for all channels
02518	Probe reset	Probe reset: The probe performs a reset
00503	Reset device to fact	A factory reset of the transmitter was performed
02503	Reset probe to fact	A factory reset of the probe was performed
00530	Change solenoid valve	The solenoid valve should be changed
00307	User Setting Change	User Setting Change: General settings were changed for the transmitter.
00117	Adjustment DeltaP	An n-point adjustment was performed.
02104	Analog adjustment	An analog adjustment has been made
02101	1-point adjustment	A 1-point adjustment is performed.
02102	2-point adjustment 11.3 %	As part of the 2-point adjustment, an adjustment is performed at 11.3 % RH
02103	2-point adjustment 75.3 %	As part of the 2-point adjustment, an adjustment is performed at 75.3 % RH
02120	2-point adjustment 20 %	As part of the 2-point adjustment, an adjustment is performed at 20 % RH
02130	2-point adjustment 80 %	As part of the 2-point adjustment, an adjustment is performed at 80 % RH
02105	Self-adjustment active	For testo 6615 probe only: The probe performs an automatic self-adjustment

4.5.2. Warning messages

Warning messages show an early warning or a current malfunction which may negatively impact measuring.

which may negatively impact measuring.				
Message	Display	Cause	Remedying of fault	
00809	Pressure too high**	The process pressure exceeds the pressure intended for the transmitter	Remove the transmitter from the process and take any necessary measures to lower the pressure	
00E00	T ambient high**	The ambient temperature exceeds the permissible temperature for the transmitter	Take necessary measures to lower ambient temperature, e.g. through venting or cooling	
00E01	T ambient low**	The ambient temperature is below the permissible temperature for the transmitter	Take necessary measures to raise ambient temperature, e.g. through heating	
00E04/00E 05	Supply voltage low**	The supply voltage is below the minimum voltage required for the transmitter	Take measures to ensure sufficient voltage supply	
02822	T process high**	The process temperature exceeds the temperature designated for the probe	Remove the probe from the process and take any necessary measures to lower the process temperature	
02821	T process low**	The process temperature is below the temperature designated for the probe	Take necessary measures to raise process temperature	
0081C	Alarm 1**	Depending on the parameterization of the relays	Depending on the parameterization of the relays	
0081D	Alarm 2**	Depending on the parameterization of the relays	Depending on the parameterization of the relays	

Message	Display	Cause	Remedying of fault
0081E	Alarm 3**	Depending on the parameterization of the relays	Depending on the parameterization of the relays
0081F	Alarm 4**	Depending on the parameterization of the relays	Depending on the parameterization of the relays
02900	2-point adjustment drift*	In the 2-point adjustment, corrections repeatedly occur in the same direction; this may indicate a sensor drift	Send the probe into Testo Service
02806	Condensation*	100 % RH has been reached, condensation developing	Take measures to reduce process humidity
02807	Values less than 0 % RH**	The adjustment or sensor is faulty	Check adjustment (via P2A adjustment history, perform 2-point adjustment where necessary). If the problem persists, contact Testo Service
02809	Sensor early warning*	For testo 6617 probe only: The cover electrode of the sensor is damaged; this may soon cause the sensor to break	Carry out visual inspection. If the mirror-like surface of the sensor is dirty or damaged, contact Testo Service

^{*} Early warning

^{**} Current malfunction

4.5.3. Transmitter error messages

Error messages show a current malfunction.

Message	Display	Cause	Remedying of fault
03401	No probe signal	The probe communication is interrupted	Ensure that the probe connector is fully engaged in the transmitter. If communication still
			cannot be established, contact Testo Service
03508	Wrong probe	The connected probe is not compatible with the present transmitter	Use a compatible probe Note: Probe 661x for transmitter 638x
01505	Watchdog error	Due to a processor error, the transmitter performs an automatic restart	If the problem occurs frequently, contact Testo Service
0300A	% RH short- circuit	Short-circuit in humidity sensor	Contact Testo Service
0300B	% RH sensor broken	The humidity sensor is damaged (sensor broken)	Contact Testo Service
0300C	T short-circuit	Short-circuit in temperature sensor	Contact Testo Service
0300D	T sensor broken	The temperature sensor is damaged (sensor broken)	Contact Testo Service
03105	Self-adjustment error	For testo 6615 probe only: The automatic self-adjustment was faulty	Contact Testo Service
03106	Adjustment error	The adjustment of the probe was faulty	Contact Testo Service
01115	Low adjustment temperature	The ambient temperature is too low during the pressure adjustment	Take necessary measures to raise ambient temperature, e.g. through heating

Message	Display	Cause	Remedying of fault
01116	High adjustment temperature	The ambient temperature is too high during the pressure adjustment	Take necessary measures to lower ambient temperature, e.g. through venting.
03000	Heat function defective	For testo 6614 probe only: Heat function defective	Contact Testo Service

4.5.4. Handling alarm messages

	3	
Shown on the display ⁵		
New limit value	х	
Scaling changed	х	
Pressure too high	х	х
Delta p adjustment	х	
Alarm 1		х
Alarm 2		х
Alarm 3		х
Alarm 4		х
Transmitter reset	х	
Reset Min/Max		
Transmitter refresh	х	
User Setting Change		
Analog adjustment	х	

⁵ If multiple messages/alarms are activated at the same time, only the last message/alarm is shown. If this is cancelled, the other messages that are still active are no longer displayed.

⁶ The message can be assigned the collective alarm function, which means that the collective alarm is activated as soon as at least one of the messages assigned to it is activated. The collective alarm can be assigned to each of the 4 optional relays. The collective alarm is then always the same, as it can only be defined once.

⁷ The message is shown upon the occurrence of the event causing the message as well as when closing. Two entries appear in the history in the P2A software: Message text start and Message text end.

Shown on the display ⁵	Can be used for collective alarm ⁶	Additional message end ⁷
1-point adjustment	х	
2-point adjustment 11.3%	Х	
2-point adjustment 75.3 %	х	
Probe reset	х	
2-point adjustment drift	х	
T ambient high	х	х
T ambient low	Х	X
Supply voltage low	X	X
T process high	X	Х
T process low	X	Х
Condensation	X	X
Values less than 0 % RH	Х	Х
Sensor early warning	х	
No probe signal	х	
Watchdog error	х	
% RH short-circuit	х	х
% RH sensor broken	х	Х
T short-circuit	х	х
T sensor broken	х	Х
Heat function defective	Х	Х

Perform the Confirm message function (acknowledgement of the alarm via the control keys on the transmitter):

- The message/alarm is no longer shown on the display and the optical alarm goes out, where applicable. If multiple messages/alarms are active at the same time, all are reset simultaneously.
- If at least one message is assigned to the collective alarm, the collective alarm is reset. If the collective alarm is set on a relay, the relay is also reset, meaning switched to its neutral position.

4.5.5. Namur fault conditions

If the faults named in the following table occur, the analog outputs output special values that enable a general fault warning in the higher-level control system. The values correspond to the "Namur" industry standard.

Status message in the display	Display value in display	Class	Analog output				
			0 to 20 mA	4 to 20 mA	1 V	5 V	10 V
No probe signal	None	Error	21 mA	21 mA	1.1 V	5.5 V	11 V
Wrong probe	None	Error	21 mA	21 mA	1.1 V	5.5 V	11 V
Values < 0 %RH	uuuuu	Underrange	0 mA	3.8 mA	0 V	0 V	0 V
Condensation	00000	Overrange	20.5 mA	20.5 mA	1.1 V	5.5 V	11 V
% RH short- circuit		Error	21 mA	21 mA	1.1 V	5.5 V	11 V
% RH sensor broken		Error	21 mA	21 mA	1.1 V	5.5 V	11 V
T short-circuit		Error	21 mA	21 mA	1.1 V	5.5 V	11 V
T sensor broken		Error	21 mA	21 mA	1.1 V	5.5 V	11 V
T process low	uuuuu	Underrange	0 mA	3.8 mA	0 V	0 V	0 V
T process high	00000	Overrange	20.5 mA	20.5 mA	1.1 V	5.5 V	11 V
Probe disconnected	None	Error	21 mA	3.8 mA	1.1 V	5.5 V	11 V
Watchdog error	Previous value stops	Error	21 mA	3.8 mA	1.1 V	5.5 V	11 V
Value below min. scale	Reading	Underrange	0 mA	3.8 mA	0 V	0 V	0 V

Status message in the display	Display value in display	Class	Analog output				
Value above max. scale	Reading	Overrange	20.5 mA	20.5 mA	1.1 V	5.5 V	11 V
Pressure too high	00000	Overrange	20.5 mA	20.5 mA	1.1 V	5.5 V	11 V
Heat function defective		Error	21 mA	21 mA	1.1 V	5.5 V	11 V

4.6. Maintenance and cleaning

4.6.1. Maintaining the instrument

We recommend that the adjustment and settings of the transmitter be checked at regular intervals using the

- · User menu (Operation, page 49) or
- P2A software (volume 2, Parameterizing, adjusting and analyzing software (P2A software), page 112)

Convenient "remote monitoring" of the transmitter can be implemented, for example by using a relay as a collective alarm (see Using alarm as collective alarm or not using it at all, page 56) whose messages are forwarded to a local alarm transmitter (horn, light) or PLC.

4.6.2. Cleaning the instrument

Integrated humidity probe

The humidity sensor of the integrated humidity probe in particular must be protected.



The sensors of the integrated humidity probe must not make contact with cleaning agents, otherwise the functionality can no longer be guaranteed.

- 1. Put supplied plastic cap on the integrated humidity probe.
- Wipe surface of the instrument with mild cleaning agents and a soft cloth.
- 3. Remove plastic cap.

Instrument surface

- ✓ Integrated humidity probe is protected by the plastic cap.
- Clean the surface of the instrument with mild cleaning agents (e.g. washing-up liquid) and water. Only use gentle and standard cleaners.
- Do not use any aggressive or chafing cleaning agents such as thinner, liquid scouring agent, wax, benzine, concentrated acids and lyes.
- Carefully rub down the instrument surface with a moist and soft cloth.