

Version 2.0 English

- when it has to be **right** 



### 2

### Introduction

Purchase

Congratulations on the purchase of a Leica NA720/724/728/730/730 plus.





This manual contains important safety directions as well as instructions for setting up the product and operating it. Refer to "1 Safety Directions" for further information.

Read carefully through the User Manual before you switch on the product.

Product identification The type and serial number of your product are indicated on the type plate. Enter the type and serial number in your manual and always refer to this information

Type:	
Serial No.:	

### Symbols

The symbols used in this manual have the following meanings:

Туре		Description
$\triangle$	DANGER	Indicates an imminently hazardous situation which, if not avoided, will result in death or serious injury.
/:\		Indicates a potentially hazardous situation or an unintended use which, if not avoided, could result in death or serious injury.
$\triangle$	CAUTION	Indicates a potentially hazardous situation or an unintended use which, if not avoided, may result in minor or moderate injury.
NOTICE		Indicates a potentially hazardous situation or an unintended use which, if not avoided, may result in appreciable material, financial and environmental damage.
		Important paragraphs which must be adhered to in practice as they enable the product to be used in a technically correct and efficient manner.

# Validity of this manual

This manual applies to the NA720/724/728/730/730 plus instruments. Differences between the various models are marked and described.

NA720/724/728/730/730 plus, Introduction

### NA720/724/728/730/730 plus, Introduction

Available documentation

Name	Description/Format	 200
NA720/724/ 728/730/730 plus User Manual	All instructions required in order to operate the product to a basic level are contained in the User Manual. Provides an overview of the product together with technical data and safety directions.	<b>✓</b>

Refer to the following resources for all NA720/724/728/730/730 plus documentation:

### Table of Contents

In this manual	Ch	napte	r	Page
	1	Saf	ety Directions	7
		1.1	General Introduction	7
		1.2	Definition of Use	8
		1.3	Limits of Use	9
		1.4	Responsibilities	10
		1.5	Hazards of Use	11
	2	Des	scription of the System	15
		2.1	Container Contents	16
		2.2	Instrument Components	17
		2.3	Understanding Terms and Expressions	18
	3	Оре	eration	20
		3.1	Preparation	20
		3.2	Measurement	27
		3.3	Check & Adjust	37
NA720/724/728/7	30/73	0 plus	s, Table of Contents	5

www. GlobalTestSupply. com

NA720/724/728/730/730 plus, Table of Contents			•
	4	Care and Transport	42
	_	4.1 Transport	42
		4.2 Storage	43
		4.3 Cleaning and Drying	44
	5	Technical Data	4!
	6	Accessories	48

# Safety DirectionsGeneral Introduction

### Description

The following directions enable the person responsible for the product, and the person who actually uses the equipment, to anticipate and avoid operational hazards.

The person responsible for the product must ensure that all users understand these directions and adhere to them.

NA720/724/728/730/730 plus, Safety Directions

### 1.2 Definition of Use

### Intended Use

- Optical height readings.
- Optical distance measuring with stadia readings.

### Reasonably foreseeable misuse

- Use of the product without instruction.
- Use outside of the intended use and limits.
- Disabling safety systems.
- Removal of hazard notices.
- Opening the product using tools, for example screwdriver, unless this is permitted for certain functions.
- Modification or conversion of the product.
- Use after misappropriation.
- Use of products with recognisable damages or defects.
- Use with accessories from other manufacturers without the prior explicit approval of Leica Geosystems.
- Aiming directly into the sun.
- Inadequate safeguards at the working site.

www.GlobalTestSupply.com

### 1.3 Limits of Use

**Environment** 

Suitable for use in an atmosphere appropriate for permanent human habitation: not suitable for use in aggressive or explosive environments.

⚠

DANGER

Local safety authorities and safety experts must be contacted before working in hazardous areas, or close to electrical installations or similar situations by the person in charge of the product.

NA720/724/728/730/730 plus, Safety Directions

### 1.4

### Responsibilities

### Manufacturer of the product

Leica Geosystems AG, CH-9435 Heerbrugg, hereinafter referred to as Leica Geosystems, is responsible for supplying the product, including the user manual and original accessories, in a safe condition.

# Person responsible for the product

The person responsible for the product has the following duties:

- To understand the safety instructions on the product and the instructions in the user manual.
- To ensure that it is used in accordance with the instructions.
- To be familiar with local regulations relating to safety and accident prevention.
- To inform Leica Geosystems immediately if the product and the application becomes unsafe.
- To ensure that the national laws, regulations and conditions for the operation of e.g. radio transmitters or lasers are respected.

### 1.5

### Hazards of Use



CAUTION

Watch out for erroneous measurement results if the product has been dropped or has been misused, modified, stored for long periods or transported.

### Precautions:

Periodically carry out test measurements and perform the field adjustments indicated in the user manual, particularly after the product has been subjected to abnormal use and before and after important measurements.



DANGER

Because of the risk of electrocution, it is dangerous to use poles and extensions in the vicinity of electrical installations such as power cables or electrical railways.

### Precautions:

Keep at a safe distance from electrical installations. If it is essential to work in this environment, first contact the safety authorities responsible for the electrical installations and follow their instructions.



NOTICE

Strong magnetic fields in the immediate vicinity (e.g. transformers, melting furnaces...) may influence the compensator and lead to measuring errors.

NA720/724/728/730/730 plus, Safety Directions

### Precautions:

When working near strong magnetic fields, check results for plausibility.



Be careful when pointing the product towards the sun, because the telescope functions as a magnifying glass and can injure your eyes and/or cause damage inside the product.

### Precautions:

Do not point the product directly at the sun.



During dynamic applications, for example stakeout procedures there is a danger of accidents occurring if the user does not pay attention to the environmental conditions around, for example obstacles, excavations or traffic.

### Precautions:

The person responsible for the product must make all users fully aware of the existing dangers.



Inadequate securing of the working site can lead to dangerous situations, for example in traffic, on building sites, and at industrial installations.

### **Precautions:**

Always ensure that the working site is adequately secured. Adhere to the regulations governing safety and accident prevention and road traffic.



If the accessories used with the product are not properly secured and the product is subjected to mechanical shock, for example blows or falling, the product may be damaged or people can sustain injury.

### **Precautions:**

When setting-up the product, make sure that the accessories are correctly adapted, fitted, secured, and locked in position.

Avoid subjecting the product to mechanical stress.



If the product is used with accessories, for example masts, staffs, poles, you may increase the risk of being struck by lightning.

### Precautions:

Do not use the product in a thunderstorm.



If the product is improperly disposed of, the following can happen:

- If polymer parts are burnt, poisonous gases are produced which may impair health.
- If batteries are damaged or are heated strongly, they can explode and cause poisoning, burning, corrosion or environmental contamination.
- By disposing of the product irresponsibly you may enable unauthorised persons
  to use it in contravention of the regulations, exposing themselves and third
  parties to the risk of severe injury and rendering the environment liable to
  contamination.

NA720/724/728/730/730 plus, Safety Directions

### Precautions:



The product must not be disposed with household waste. Dispose of the product appropriately in accordance with the national regulations in force in your country.

Always prevent access to the product by unauthorised personnel.

Product-specific treatment and waste management information can be downloaded

 $\triangle$ 

WARNING

Only Leica Geosystems authorised service workshops are entitled to repair these products.

### 2 Description of the System

# General descrip-

The NA720/724/728/730/730 plus is a member of a new generation of construction levels.

Its innovative technology makes the daily surveying jobs easier.

The instrument is ideally suited for all applications of a reliable and robust construction level.


The easy operation of the instrument functions can be quickly learned even by inexperienced surveyors.

- Easy operation; quickly to learn!
- Attractive design; low weight.
- Endless drive.
- Robust and reliable.
- $\bullet$   $\;$  Enables angle measurements with horizontal circle (choice of ° or gon).
- Resistant to water and dirt (IP57).
- $\bullet$   $\;$  Adaptable to all types of tripods with 5/8" central fixing screw.
- Nitrogen filled telescope to prevent fogging the lens.
- 3 years without additional costs with Leica Protect.
- Produced (in accordance to ISO 9001 and ISO 14001) and proofed with ISO 17123-2
- Swiss technology

NA720/724/728/730/730 plus, Description of the System


### 2.1 Container Contents

### **Container contents**

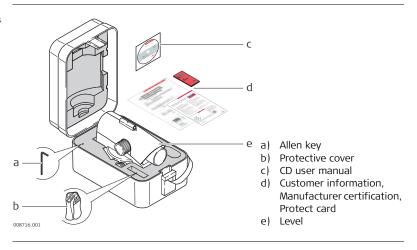

#### 2.2 **Instrument Components**

Instrument components

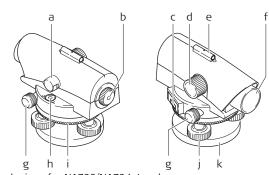


- a) Level mirror for NA720/NA724; Level prism for NA728/NA730/NA730 plus
- . Eyepiece
- c) Cover glass for angle reading (° or gon)
- d) Focusing knob
- Coarse aiming device (back/fore-sight for NA720/NA724; optical sight with point marking for NA728/NA730/NA730 plus)
- Objective
- Endless drive (both sides)
- Circular level
  - Knurled ring of adjustable horizontal circle
- j) Footscrew k) Base plate

NA720/724/728/730/730 plus, Description of the System

### 2.3

### **Understanding Terms and Expressions**


### Plumb line

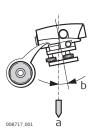

- a) Plumb line
- b) Vertical axis tilt

By centring the circular level the instrument is nearly levelled up. A small instrument tilt remains (the vertical axis tilt).


### Compensator

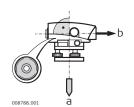

- a) Plumb line
- b) Line of sight

The compensator in the instrument is responsible for compensating the vertical axis tilt enabling an exactly horizontal aiming.

Backsight/Foresight/Intermediate sight

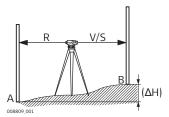


For determining the height difference ( $\Delta H$ ) between the ground points A and B the back sight (R) is measured first followed by the forward sight (V). Additional points relating to A are measured as intermediate sight (S).

NA720/724/728/730/730 plus, Description of the System

## 3 Operation


### 3.1 Preparation

Tripod

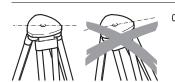

When setting up the tripod pay attention to ensuring a horizontal position of the tripod plate. Slight corrections of inclination can be made with the foot screws of the tribrach. Larger corrections must be

done with the tripod legs.

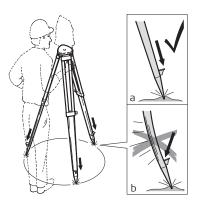

Loosen the clamping screws on the tripod legs, pull out to the required length and tighten the clamps.

- a) In order to guarantee a firm foothold sufficiently press the tripod legs into the ground.
- b) When pressing the legs into the ground note that the force must be applied along the legs.



Careful handling of tripod.

- Check all screws and bolts for correct fit.
- During transport always use the cover supplied.
- Use the tripod only for surveying tasks.

NA720/724/728/730/730 plus, Operation


Levelling up, step-by-step

- 1. Place level onto tripod head. Tighten central fixing screw of tripod.
- 2. Turn footscrews of tribrach into its centre position.
- 3. Centre circular level by turning the foot-screws.




### Centring the circular level


 Turn footscrews A and B simultaneously in opposite directions until bubble is in the centre (on the imaginary "T").

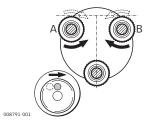


2. Turn footscrew C until bubble is centred.

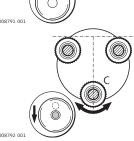



NA720/724/728/730/730 plus, Operation

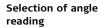




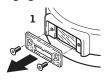

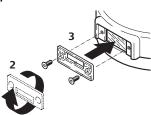

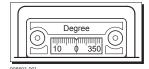

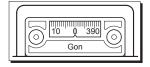

Step	Description	
1.	Loosen screws with Allen key and remove cover glass.	
2.	Turn cover glass.	
3.	Insert cover glass and tighten screws again.	

### Focusing telescope

Step	Description	
1.	Aim telescope against a bright background (e.g. white paper).	
2.	Turn eyepiece until reticule is sharp-focused and deep black. Now the eyepiece is adapted to your eye.	
		008816,001
3.	Aim telescope on staff using the coarse aiming device.	
4.	Turn focusing knob until image of staff is sharply focused. If the eye is moved up and down behind the eyepiece the image of the staff and the reticle may not be displaced against each other.	008817,001

NA720/724/728/730/730 plus, Operation

### NA720/724/728/730/730 plus, Operation

### Centring

Step	Description	
For pos	ssible centring over a ground point:	
1.	Attach plumb bob.	
2.	Loosen central fixing screw slightly and shift instrument parallel on tripod until the plummet is exactly over the point.	
3.	Tighten central fixing screw.	00818,001

#### 3.2 Measurement

### Height reading



Before starting field work or after longer periods of storage/transport of your equipment check the field adjustment parameters specified in this User Manual.



Reduce possible vibrations by holding the tripod legs. If the optical parts of your instrument are dirty of fogged, your measure-


ments can be affected. Keep clean all optical parts of your instrument and follow the cleaning instructions specified in the User Manual.

Step	Description	
1.	Setup instrument, level and sharp-focus the reticule.	d
2.	Setup level staff vertically (refer also to Instruction Manual of staff).	
3.	Roughly aim on staff using the coarse aiming device.	
4.	Sharp-focus using the focusing knob.	008793_001

NA720/724/728/730/730 plus, Operation

Step	Description	
5.	Fine-aim on staff using the endless drives.	27
6.	Check if circular level is centred (view level prism/level mirror).	26
7.	Read off height H at the centre hair of the reticle. Example above: H = 2.585 m	08795.001

Distance measuring Carry out steps 1 to 6 according to height reading.

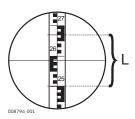


Reading:

Upper distance line: 2.670 m Lower distance line: 2.502 m Difference L: 0.168 m Distance d: 16.8 m

Result: Distance d = 100 x L

### Angle measuring

The NA720/724/728/730/730 plus is equipped with a horizontal circle. The graduation is  $1^\circ$  or 1 gon.

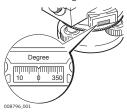

### Wanted:


Angle between point A and point B.

Carry out steps 1 to 6 according to height measuring. By doing so, align the vertical hair of the reticle to the centre of the staff.

NA720/724/728/730/730 plus, Operation

Step	Description	
1.	Turn Hz-circle to "0".	Δ P
2.	Align instrument to point B and aim on the centre of the staff.	
3.	Read off Hz-angle from Hz-circle: Example above: Hz = 60°.	Degree 770 60 50 008797.001

### Line levelling

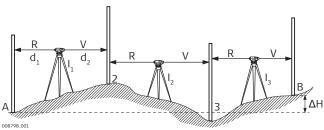

### Wanted:

Height difference ( $\Delta H$ ) between point A and B.



Select instrument station and staff location by pacing off so, that approximately the same target distances result ( $d1 \approx d2$ ; approx. 40 to 50m).

### Procedure:

Step	Description
1.	Setup instrument at I <sub>1</sub> .
2.	Setup level staff vertically at point A.
3.	Aim on staff and read off and take down height (backsight R).
4.	Setup level at the changepoint 2, aim on staff and read off and take down height (foresight V).
5.	Setup level at $I_2$ , aim on staff at the changepoint 2 and read backsight and take down.
6.	Carry out a foresight at changepoint 3.
7.	Continue in the same way until height at point B is measured.

### Result:


 $\Delta H$  = sum backsight - sum foresight

NA720/724/728/730/730 plus, Operation

### Example of the booking:

Point No.	Backsight R	Foresight V	Height
А	+2.502		650.100
2	+0.911	-1.803	
3	+3.103	-1.930	
В		-0.981	651.902
Sum	+6.516	-4.714	ΔH= +1.802

### Area levelling

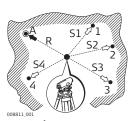

Wanted:

Height difference of several reference points.



The required accuracy is usually not very high with such measurements. Nevertheless, from time to time read the staff on a stable intermediate point (reading must remain the same).

### Procedure:

Step	Description
1.	Set up instrument centrally between the desired points. The instrument telescope may not be below the highest measured intermediate point.
2.	Set up staff vertically at reference point A.
3.	Aim on staff and read and take down height (=backsight to known point).
4.	Set up staff vertically at point 1.
5.	Aim on staff and read and take down height (=measuring intermediate point, intermediate sight)
6.	Repeat steps 4 and 5 for additional intermediate points.
7.	The height of individual points are: Height = Height of station point + backsight (A) - intermediate sight


NA720/724/728/730/730 plus, Operation

### Example of the booking:

Point No.		Interm. sight	Height
А	592.00		
R1	+2.20		
$\otimes$	594.20		
S1		-1.80	592.40
S2		-1.90	592.30
S3		-2.50	591.70
54		-2.30	591.90

⊗ = Instrument horizon

Levelling total station measuring

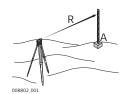

Backsight to known point

Wanted:

Position of several ground points.



The levelling total station measuring is normally carried out during area levelling.

### Procedure:

Step	Description
1.	Sequence of measurements is the same as with area levelling. However, beside the height read also the staff section L (see chapter "Distance measuring") and the Hz-angle.
2.	Transfer measured value into the map - points are determined by position and height.

NA720/724/728/730/730 plus, Operation

### Levelled stakeout



Measuring ground points

The stakeout is the counterpart to the levelling total station measuring - map points are set out in the field.


### Procedure:

Step	Description
1.	Set up instrument at a known point, centre and level up.
2.	Focus instrument and aim on known orientation point.
3.	Orient horizontal circle (Hz-direction).
4.	Move staff to stakeout point on the basis of known values (distance and Hzangle, height) and stakeout point.

## 3.3

# Check & Adjust

Service the tripod step-by-step

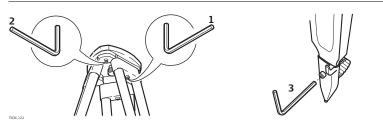

- The connections between metal and timber components must always be firm and tight.
- 1) Tighten the leg cap screws moderately with the allen key supplied.
- 2) Tighten the articulated joints on the tripod head just enough to keep the tripod legs open when lifting the tripod off the ground.
- 3) Tighten the screws of the tripod legs.

NA720/724/728/730/730 plus, Operation

# Circular Level

Step	Description	
1.	Level up instrument.	Δμ
2.	Turn instrument by 180°.	
3.	If bubble of level is outside the circle then it should be adjusted (see point 4.).	2 008799.001
4.	Correct the half error using an Allen key and repeat steps 2 and 3 until the bubble of level is in the centre in any telescope direction.	Δ/2 00800,001

# Checking the line of sight

Step	Description	
	With the circular bubble centred and adjusted, the line of sight should be horizontal.	H=1.832 H=1.616 δ
1.	Choose a distance of appr. 30 m within a gentle terrain.	
2.	Set up a staff at both final points (A, B).	A B B d
3.	Set up the instrument at point I <sub>1</sub> (halfway between A and B, just pass it down) and centre the bubble.	008979,001
4.	Read both staffs. Reading on A = 1.832 m Reading on B = 1.616 m $\Delta$ H = A - B = 0.216 m	

NA720/724/728/730/730 plus, Operation

Step	Description	
5.	Set up the level about 1 m from staff A.	actual = 1.604 δ
6.	Read staff A (eg.: 1.604 m).	nominal = 1.388 = =
7.	Find nominal reading B; eg.: Reading A - $\Delta$ H = 1.604 m - 0.216 m = 1.388 m.	A B B
8.	Read staff B, compare nominal- /actual- reading.	008980,001_en

# Adjusting the line of sight

Step	Description	
	When the difference nominal-/actual- reading is more than 3 mm the line of sight must be adjusted.	
1.	Turn the allen key until the middle hair gives the required reading (eg. 1.388 m).	
2.	Check line of sight again.	008815 001
	Before starting field work or after long periods of storage/ transport of your equipment check the field adjustment parameters specified in this User Manual.	

NA720/724/728/730/730 plus, Operation

#### 4

# Care and Transport

#### 4.1

### Transport

# Transport in the field

When transporting the equipment in the field, always make sure that you

- either carry the product in its original transport container,
- or carry the tripod with its legs splayed across your shoulder, keeping the attached product upright.

# Transport in a road vehicle

Never carry the product loose in a road vehicle, as it can be affected by shock and vibration. Always carry the product in its transport container, original packaging or equivalent and secure it.

#### **Shipping**

When transporting the product by rail, air or sea, always use the complete original Leica Geosystems packaging, transport container and cardboard box, or its equivalent, to protect against shock and vibration.

#### Field adjustment

Periodically carry out test measurements and perform the field adjustments indicated in the User Manual, particularly after the product has been dropped, stored for long periods or transported.

#### 4.2 **Storage**

Product Respect the temperature limits when storing the equipment, particularly in summer

if the equipment is inside a vehicle. Refer to "5 Technical Data" for information about

temperature limits.

After long periods of storage inspect the field adjustment parameters given in this Field adjustment

user manual before using the product.

NA720/724/728/730/730 plus, Care and Transport

## 4.3


# **Cleaning and Drying**

# Product and accessories

- Blow dust off lenses.
- · Never touch the glass with your fingers.
- Use only a clean, soft, lint-free cloth for cleaning. If necessary, moisten the cloth with water or pure alcohol. Do not use other liquids; these can attack the polymer components.

## Damp products

Dry the product, the transport container, the foam inserts and the accessories at a temperature not greater than  $+40^{\circ}\text{C}/+104^{\circ}\text{F}$  and clean them. Do not repack until everything is dry. Always close the transport container when using in the field.

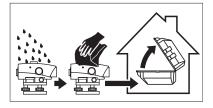

# 5 Technical Data

Accuracy	Standard deviation	for 1 km	double	levelling	ISO17123-2:

 NA720:
 2.5 mm

 NA724:
 2.0 mm

 NA728:
 1.5 mm

 NA730:
 1.2 mm

 NA730 plus:
 0.7 mm

Height accuracy for a single measurement at 30 m:

 NA720:
 1.5 mm

 NA724:
 1.2 mm

 NA728:
 1 mm

 NA730:
 0.8 mm

 NA730 plus:
 0.4 mm

**Telescope** Erect image

Magnification

NA720: 20 x NA724: 24 x NA728: 28 x NA730/NA730 plus: 30 x

NA720/724/728/730/730 plus, Technical Data

	Field of view (at 100 m):	> 4 m (NA720) > 3.5 m (NA724)
	Shortest target distance:	<ul><li>3 m (NA728/NA730/NA730 plus)</li><li>0.5 m (NA720/NA724)</li><li>0.7 m (NA728/NA730/NA730 plus)</li></ul>
Distance measure- ment	Multiplication factor: Additive constant: Resolution (higher than)	100 (all instruments) 0 (all instruments) 4" (NA720) 3.5" (NA724)
		3" (NA728/NA730/NA730 plus)
Compensator	Working range: Setting accuracy (standard deviation):	±15' 0.5"
Circular level	Sensitivity:	10'/2 mm
Circle	Graduation: Graduation interval:	360°/400gon 1°/1gon

Adaption

To normal or ball head tripod

Central fixing screw:

5/8''

Environmental specifications

## Temperature

Operating temperature	Storage temperature
-20°C to +50°C	-40°C to +70°C
(-4°F to +122°F)	(-40°F to +158°F)

NA720/724/728/730/730 plus, Technical Data

#### 6

# **Accessories**

Purchasable Accessory

