

VELOCICALC®  
AIR VELOCITY METER  
MODEL 9565 SERIES

---

OPERATION AND SERVICE MANUAL

P/N 6004851, REVISION F  
JUNE 2018



**Copyright©**

TSI Incorporated / 2011-2018 / All rights reserved.

**Limitation Of Warranty And Liability (effective February 2015)**

Seller warrants the goods, excluding software, sold hereunder, under normal use and service as described in the operator's manual, to be free from defects in workmanship and material for **24 months**, or if less, the length of time specified in the operator's manual, from the date of shipment to the customer. This warranty period is inclusive of any statutory warranty. This limited warranty is subject to the following exclusions and exceptions:

- a. Hot-wire or hot-film sensors used with research anemometers, and certain other components when indicated in specifications, are warranted for 90 days from the date of shipment;
- b. Carbon monoxide (CO) Electro-chemical sensors are warranted for 12 months from the date of shipment.
- c. Pumps are warranted for hours of operation as set forth in product or operator's manuals;
- d. Parts repaired or replaced as a result of repair services are warranted to be free from defects in workmanship and material, under normal use, for 90 days from the date of shipment;
- e. Seller does not provide any warranty on finished goods manufactured by others or on any fuses, batteries or other consumable materials. Only the original manufacturer's warranty applies;
- f. This warranty does not cover calibration requirements, and seller warrants only that the instrument or product is properly calibrated at the time of its manufacture. Instruments returned for calibration are not covered by this warranty;
- g. This warranty is **VOID** if the instrument is opened by anyone other than a factory authorized service center with the one exception where requirements set forth in the manual allow an operator to replace consumables or perform recommended cleaning;
- h. This warranty is **VOID** if the product has been misused, neglected, subjected to accidental or intentional damage, or is not properly installed, maintained, or cleaned according to the requirements of the manual. Unless specifically authorized in a separate writing by Seller, Seller makes no warranty with respect to, and shall have no liability in connection with, goods which are incorporated into other products or equipment, or which are modified by any person other than Seller.

The foregoing is **IN LIEU OF** all other warranties and is subject to the **LIMITATIONS** stated herein. **NO OTHER EXPRESS OR IMPLIED WARRANTY OF FITNESS FOR PARTICULAR PURPOSE OR MERCHANTABILITY IS MADE. WITH RESPECT TO SELLER'S BREACH OF THE IMPLIED WARRANTY AGAINST INFRINGEMENT, SAID WARRANTY IS LIMITED TO CLAIMS OF DIRECT INFRINGEMENT AND EXCLUDES CLAIMS OF CONTRIBUTORY OR INDUCED INFRINGEMENTS. BUYER'S EXCLUSIVE REMEDY SHALL BE THE RETURN OF THE PURCHASE PRICE DISCOUNTED FOR REASONABLE WEAR AND TEAR OR AT SELLER'S OPTION REPLACEMENT OF THE GOODS WITH NON-INFRINGEMENT GOODS.**

TO THE EXTENT PERMITTED BY LAW, THE EXCLUSIVE REMEDY OF THE USER OR BUYER, AND THE LIMIT OF SELLER'S LIABILITY FOR ANY AND ALL LOSSES,

INJURIES, OR DAMAGES CONCERNING THE GOODS (INCLUDING CLAIMS BASED ON CONTRACT, NEGLIGENCE, TORT, STRICT LIABILITY OR OTHERWISE) SHALL BE THE RETURN OF GOODS TO SELLER AND THE REFUND OF THE PURCHASE PRICE, OR, AT THE OPTION OF SELLER, THE REPAIR OR REPLACEMENT OF THE GOODS. IN THE CASE OF SOFTWARE, SELLER WILL REPAIR OR REPLACE DEFECTIVE SOFTWARE OR IF UNABLE TO DO SO, WILL REFUND THE PURCHASE PRICE OF THE SOFTWARE. IN NO EVENT SHALL SELLER BE LIABLE FOR LOST PROFITS, BUSINESS INTERRUPTION, OR ANY SPECIAL, INDIRECT, CONSEQUENTIAL OR INCIDENTAL DAMAGES. SELLER SHALL NOT BE RESPONSIBLE FOR INSTALLATION, DISMANTLING OR REINSTALLATION COSTS OR CHARGES. No Action, regardless of form, may be brought against Seller more than 12 months after a cause of action has accrued. The goods returned under warranty to Seller's factory shall be at Buyer's risk of loss, and will be returned, if at all, at Seller's risk of loss.

Buyer and all users are deemed to have accepted this LIMITATION OF WARRANTY AND LIABILITY, which contains the complete and exclusive limited warranty of Seller. This LIMITATION OF WARRANTY AND LIABILITY may not be amended, modified or its terms waived, except by writing signed by an Officer of Seller.

## CONTENTS

<b>CHAPTER 1 UNPACKING AND PARTS IDENTIFICATION.....</b>	<b>1</b>
Bluetooth® Safety and Compliance.....	1
<b>CHAPTER 2 SETTING-UP.....</b>	<b>5</b>
Supplying Power to the Model 9565 Series.....	5
Installing the Batteries .....	5
DIP Switch Settings .....	5
Using the AC Adapter.....	6
Connecting Ventilation or IAQ Probes.....	7
Using the Telescoping Thermoanemometer Probes .....	7
Extending the Probe .....	7
Retracting the Probe.....	7
Using the Pressure Ports (9565-P).....	8
Connecting the Static Pressure Probe .....	8
Connecting an Optional Pitot Probe or Airflow (straight pitot) Probe.....	9
Thermocouple Ports .....	10
Connecting the Thermocouples .....	10
Connecting the Optional Bluetooth Portable Printer Device (Models 9565-P and 9565-X only).....	11
Connecting to a Computer.....	11
<b>CHAPTER 3 OPERATION .....</b>	<b>13</b>
Keypad Functions.....	13
Common Terms .....	14
Menus .....	15
ZERO PRESSURE.....	15
DISPLAY SETUP.....	16
SETTINGS .....	17
FLOW SET UP .....	17
VOC SETUP .....	19
ACTUAL/STANDARD SETUP .....	20
DATA LOGGING .....	21
Measurements.....	21
Log Mode/Log Settings.....	21
Choose Test .....	27
Name Test .....	27
View Data .....	28
View Stats.....	28
View Samples.....	29
Print Test .....	30
Delete Data.....	31
% Memory.....	32

ZERO CO.....	33
APPLICATIONS.....	34
CALIBRATION .....	35
BLUETOOTH FUNCTIONS (Models 9565-P and 9565-X only).....	35
Discover Devices .....	35
Discoverability.....	36
PINcode .....	36
# AutoConnects .....	36
Printing Data Using the Portable Printer (Models 9565-P and 9565-X only).....	36
TrakPro™ Data Analysis Software .....	37
LogDat2™ Downloading Software.....	37
<b>CHAPTER 4 MAINTENANCE .....</b>	<b>39</b>
Recalibration .....	39
Cases .....	39
Storage.....	39
<b>CHAPTER 5 TROUBLESHOOTING .....</b>	<b>41</b>
<b>APPENDIX A SPECIFICATIONS.....</b>	<b>43</b>
<b>APPENDIX B OPTIONAL PLUG-IN PROBES .....</b>	<b>47</b>

## Chapter 1

### **Unpacking and Parts Identification**

Carefully unpack the instrument and accessories from the shipping container. Check the individual parts against the list of components below. If anything is missing or damaged, notify TSI immediately.

1. Carrying case
2. Instrument
3. Static pressure tip (9565-P and 9565-P-NB models only)
4. Rubber tubing (9565-P and 9565-P-NB models only)
5. USB cable
6. TrakPro CD-ROM with data analysis software
7. LogDat2 CD-ROM with downloading software
8. AC adapter

This manual supports the following models:

Model	Description
9565-P	Multi-Function Ventilation Meter with Differential Pressure Sensor
9565-P-NB	Multi-Function Ventilation Meter with Differential Pressure Sensor, No Bluetooth
9565-X	Multi-Function Ventilation Meter, No Differential Pressure Sensor
9565-X-NB	Multi-Function Ventilation Meter, No Differential Pressure Sensor, No Bluetooth

#### **Bluetooth® Safety and Compliance**

This product uses Classic Bluetooth® v2.0 to communicate with software applications.

Hereby, TSI Inc. declares that this Classic Bluetooth® test and measurement instrument is in compliance with Directive 2014/53/EC.

Transmit Power Rating is +4 dBm, MAX @ 2.4 – 2.5 GHz.

**NOTE**

This device may not cause interference; this device must accept any interference, including interference that may cause undesired operation of the device.

l'appareil ne doit pas produire de brouillage; l'appareil doit accepter tout brouillage radioélectrique subi, même si le brouillage est susceptible d'en compromettre le fonctionnement.

**NOTE**

This equipment has been tested and found to comply with the limits for a Class B digital device, pursuant to part 15 of the FCC Rules (FCC ID: PI4411B). These limits are designed to provide reasonable protection against harmful interference in a residential installation. This equipment generates, uses, and can radiate radio frequency energy and, if not installed and used in accordance with the instructions, may cause harmful interference to radio communications. However, there is no guarantee that interference will not occur in a particular installation. If this equipment does cause harmful interference to radio or television reception, which can be determined by turning the equipment off and on, the user is encouraged to try to correct the interference by one or more of the following measures:

- Reorient or relocate the receiving antenna.
- Increase the separation between the equipment and receiver.
- Connect the equipment into an outlet on a circuit different from that to which the receiver is connected.
- Consult the dealer or an experienced radio/TV technician for help.

**NOTE**

This device complies with Industry Canada licence-exempt RSS standard(s). Operation is subject to the following two conditions: (1) this device may not cause interference, and (2) this device must accept any interference, including interference that may cause undesired operation of the device.



### W A R N I N G

Changes or modifications not expressly approved by the party responsible for compliance could void the user's authority to operate the equipment.

## Chapter 2

### **Setting-up**

#### **Supplying Power to the Model 9565 Series**

The Model 9565 VelociCalc® Air Velocity Meter can be powered in one of two ways: four size AA batteries or the AC adapter.

##### **Installing the Batteries**

Insert four AA batteries as indicated by the diagram located on the inside of the battery compartment. The Model 9565 is designed to operate with either alkaline or NiMH rechargeable batteries. Battery life will be shorter if NiMH batteries are used. If NiMH batteries are used the DIP switch will need to be changed. Refer to the next section, [DIP Switch Settings](#). Carbon-zinc batteries are not recommended because of the danger of battery acid leakage.

##### **DIP Switch Settings**

To access the DIP switch, remove the batteries from the battery compartment. On the inside of the battery compartment, there is a window with a single DIP switch (see figure below). The table below shows the functions for the switch.



<b>C a u t i o n</b>		
Make certain that power is turned off before changing the DIP switch settings.		

Switch	Function	Settings
1	NiMH	OFF: Alkaline Batteries ON: NiMH Rechargeable Batteries


VelociCalc is a registered trademark of TSI Incorporated.



**DO NOT** attempt to charge alkaline batteries.

### Using the AC Adapter

The AC adapter can be used to power the instrument or to charge the NiMH batteries when the DIP switch in the battery compartment is set to NiMH. If the DIP switch is set to Alkaline, and the AC power adapter is connected, then the batteries will be bypassed and the meter will be powered by the AC adapter. Be sure to provide the correct voltage and frequency, which is marked on the back of the AC adapter.

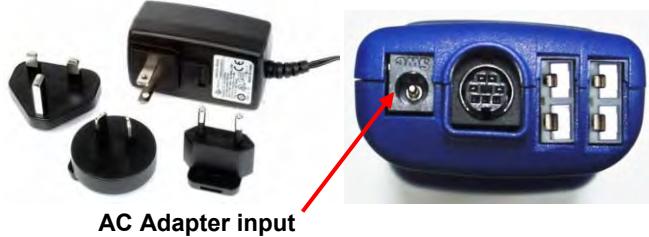

### Connecting Ventilation or IAQ Probes

The ventilation and IAQ probes have a “D” shape overmolding on the mini-DIN connector which must align with the connector at the base of the 9565 series meter. This will ensure the probe is properly connected and remains so during use. Once connected and turned on, refer to the DISPLAY SETUP for displaying the desired measurements.



### Using the Telescoping Thermoanemometer Probes

The telescoping probe contains the velocity, temperature, and humidity sensors. When using the probe, make sure the sensor window is fully exposed and the orientation dimple is facing upstream.

#### NOTE

For temperature and humidity measurements, make sure that at least 3 inches (7.5 cm) of the probe is in the flow to allow the temperature and humidity sensors to be in the air stream.

#### Extending the Probe

To extend the probe, hold the handle in one hand while pulling on the probe tip with the other hand. Do **not** hold the cable while extending the probe as this prevents the probe from extending.

#### Retracting the Probe


To retract the probe, hold the handle in one hand while gently pulling the probe cable until the smallest antenna section is retracted.



**DO NOT** use the instrument or probes near hazardous voltage sources since serious injury could result.

### Using the Pressure Ports (9565-P)

The 9565-P includes pressure ports that can be used to measure static and differential pressures in ductwork.

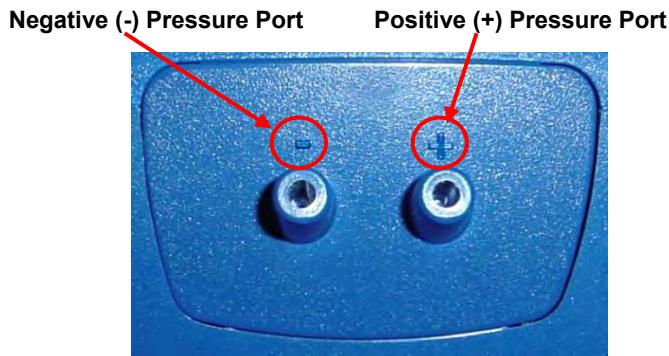

### Connecting the Static Pressure Probe

The Static Pressure probe included with the 9565-P is connected to the + port on the 9565-P using the included tubing. The Static Pressure probe is used to measure the duct static pressure and features a magnet which holds the probe to the ductwork.




### Connecting an Optional Pitot Probe or Airflow (straight pitot) Probe

When connected to a pitot probe, air velocity or air volume can be measured. A pitot probe can be connected to the "+" and "-" pressure ports on the Model 9565-P using two pieces of tubing of equal length. The total pressure port of the pitot probe connects to the "+" port on the meter, and the static pressure port of the pitot probe connects to the "-" port on the meter.

#### NOTE

The pitot velocity needs a valid temperature to perform the standard or actual velocity correction. This is accomplished in the "Actual/Std Setup" menu. If no probe capable of measuring temperature (plug in probe or thermocouple) is connected, the "Temp Source" must be set to "Entered". The duct air temperature must then be manually inputted by the user using the "Entered Temp" setting. If the "Temp Source" is set to Probe or Thermocouple 1 or 2, and no probe is connected, dashes (-----) will appear on the display.

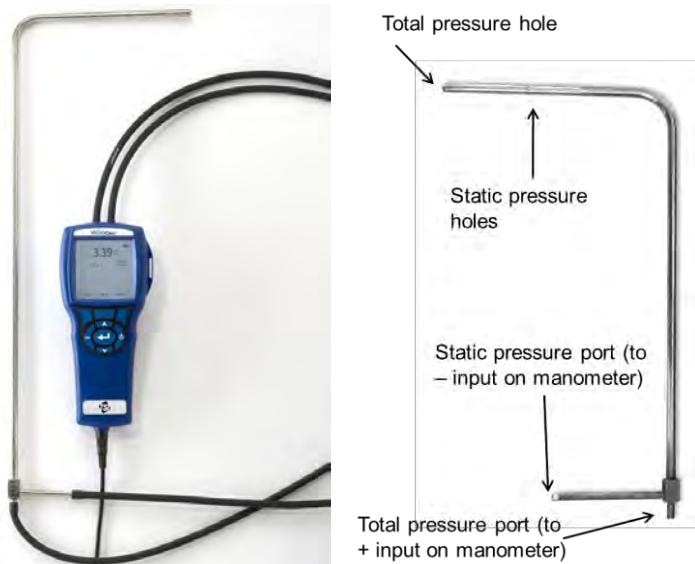




**DO NOT** use the instrument or probes near hazardous voltage sources since serious injury could result.

### Thermocouple Ports

The 9565 series includes two thermocouple ports at the base of the meter. Any K-Alloy thermocouple with mini-connector can be attached. See [Display Setup](#) for setting the thermocouple temperature readings to be displayed as TC1, TC2, or TC1-TC2.

#### Connecting the Thermocouples

The K-Alloy thermocouple with mini-connector has one terminal wider than the other. The wider terminal will be inserted into the bottom of the TC1 or TC2 connector port.

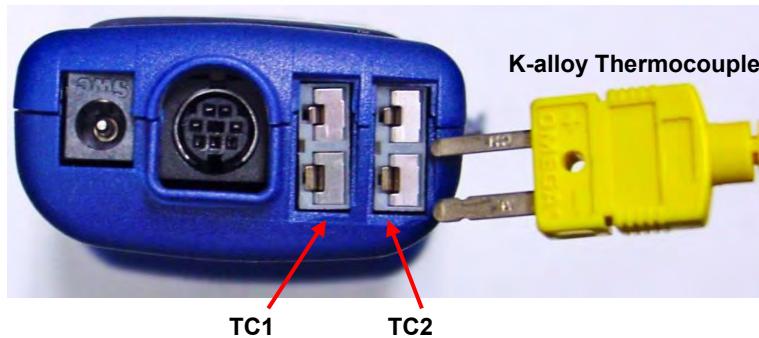

Thermocouples from an alternate TSI supplier must have the metal sheath electrically isolated from the wires inside. Failure to meet this requirement may result in false readings, electrical shock, or fire hazard.



**DO NOT** use the instrument or probes near hazardous voltage sources since serious injury could result.

### **Connecting the Optional Bluetooth® Portable Printer Device (Models 9565-P and 9565-X only)**

To connect the Bluetooth printer to the Model 9565, power on the unit and the printer. Then press the **MENU** soft key. From the Menu use the **▲** and **▼** keys to highlight **Bluetooth Functions** and press the **←** key. Highlight **Discover Devices** and press the **←** key. If other TSI Bluetooth-printers are in the area, turn them off before searching. The Model 9565 will then search for and list all available Bluetooth devices.

### **Connecting to a Computer**

Use the Computer Interface USB Cable provided with the Model 9565 to connect the instrument to a computer for downloading stored data.



**USB Communications Port**

	<b>Caution</b>
	This symbol is used to indicate that the data port of the Model 9565 is <b>not</b> intended for connection to a public telecommunications network. Connect the USB data port only to another USB port on a safety certified computing device.
	Protection provided by the instrument could be impaired if used in a manner other than specified in this user manual.

Bluetooth is a registered trademark of Bluetooth SIG.

## Chapter 3

### Operation



#### Keypad Functions

<b>ON/OFF (power) Key</b>	Press the <b>ON/OFF</b> key to turn the Model 9565 on and off. During the power up sequence the display will show the following: Model Number, Serial Number, and Software Revision. To turn the instrument off, press and <b>hold</b> the <b>ON/OFF</b> Key for 3 seconds. The instrument will count down (OFF2, OFF1, OFF). If AC Adapter is attached, the Battery and <b>ON/OFF</b> Key is bypassed. If the <b>ON/OFF</b> Key is pressed while the AC adapter is attached, the instrument instructs you to "Unplug the instrument to turn off unit". To turn the instrument on again, attach the AC adapter or press the <b>ON/OFF</b> Key.
<b>Arrow (▲▼) Keys</b>	Press to scroll through choices while setting a parameter. Pressing the <b>▲▼</b> keys simultaneously will lock the keypad to prevent unauthorized adjustments to the instruments. To unlock the keypad, press the <b>▲▼</b> keys simultaneously.
<b>Enter (←→) Key</b>	Press to accept a menu selection, value or condition. Press to Start or Stop datalogging when in Continuous Key mode.

<b>Arrow (◀ or ▶) and Menu Soft Keys</b>	Press arrow keys to change choices while setting a parameter. Press the Menu soft key to select the Menu selections, which are Pressure Zero, Display Setup, Settings, Flow Setup, VOC Setup, Actual/Std Setup, Data Logging, Zero CO, Applications, Calibration, and Bluetooth Functions.
--	--

### Common Terms


This manual has several terms used in various places. The following is a brief explanation of the meanings of those terms.

<b>Sample</b>	Consists of all of the measurement parameters stored at the same time.
<b>Test ID</b>	A group of samples. The statistics (average, minimum, maximum, and count) are calculated for each test ID. The maximum number of test IDs is 100.
<b>Time Constant</b>	The time constant is an averaging period. It is used to dampen the display. If you are experiencing fluctuating flows, a longer time constant will slow down those fluctuations. The display will update every second, but the displayed reading will be the average over the last time constant period. For example, if the time constant is 10 seconds, the display will update every second, but the displayed reading will be the average from the last 10 seconds. This is also referred to as a "moving average".
<b>Log Interval</b>	The logging interval is the period over which the instrument will average the logged sample. For example, if the logging interval is set to 30 minutes, each sample will be the average over the previous 30 minutes.
<b>Test Length</b>	This is the time over which the data will be logged in the "Continuous-Time" mode of data logging.

## Menus

The menu structure is organized to allow easy navigation and instrument setup utilizing the arrow keys and **←** button. To exit a menu or menu item, press the **ESC** key.

- To access the Menu items, press the **Menu** soft key.
- To select a parameter, use the Arrow keys to highlight the selection and press the **←** button.

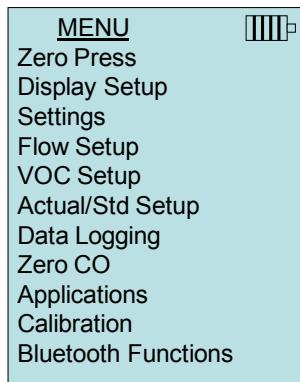


## ZERO PRESSURE

Turn the instrument on for a minimum of five minutes to let it warm up before zeroing the pressure sensor. To zero the pressure reading, leave the positive and negative ports open to atmosphere and select the **Zero Press**. The pressure sensor should be zeroed after initial warm-up and checked periodically. The instrument will indicate if the pressure zero was successful.

## DISPLAY SETUP

Display Setup menu is where you will setup the desired parameters to be displayed on the instrument screen. With a parameter highlighted you can then use the **ON** soft key to have it show up on the instrument screen or select the **OFF** soft key to turn off the parameter. Use **PRIMARY** soft key to have a parameter show up on the instrument screen in a larger display. A total of 5 parameters can be shown on the display, 1 primary (large font) and 4 secondary. Parameters shown in the Display Setup screen are dependent on the type of probe currently connected.

- When set to **PRIMARY**, measurement will be the large font on the display.
- When set to **ON**, measurement will be displayed as a secondary parameter (up to 4 can be displayed).
- When set to **OFF**, measurement will not be displayed.

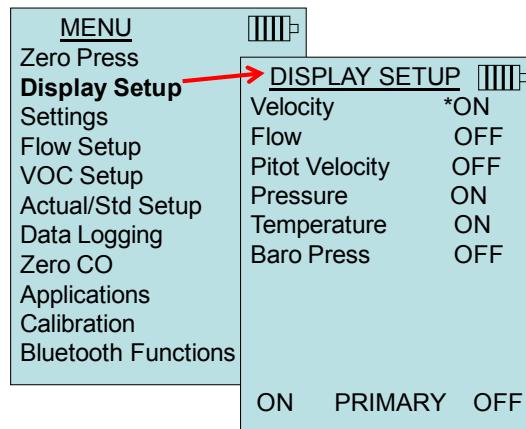


### NOTE

Pitot Velocity and AFProbe Velocity cannot both be ON at the same time, nor can one be set to **PRIMARY** and the other to ON. Only one can be ON at any given time.


## SETTINGS

**Settings** menu is where you can set the general settings. These include Language, Beeper, Select Units, Time Constant, Contrast, Set Time, Set Date, Time Format, Date Format, Number Format, Backlight and Auto Off. Use the **▲** or **▼** keys to select an option, and the **<** or **>** soft keys to change the settings for each option. Press the **←** key to accept settings.

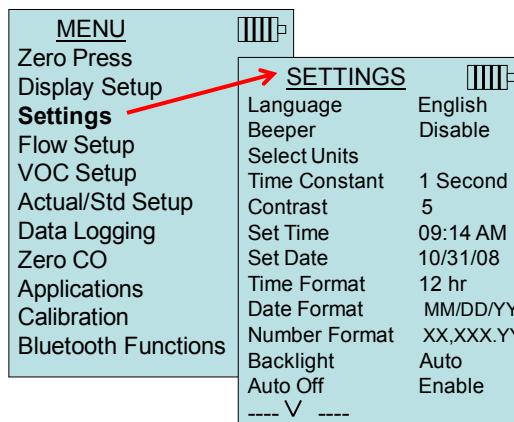

## FLOW SET UP


In **Flow Setup** mode, there are six types: Round Duct, Rectangle Duct, Duct Area, Pressure/Kfactor, Horn and Air Cone. Use the **<** or **>** soft keys to scroll through the types and then press the **←** key to accept the desired type. To change the value, highlight the **Enter Settings** option and press the **←** key.

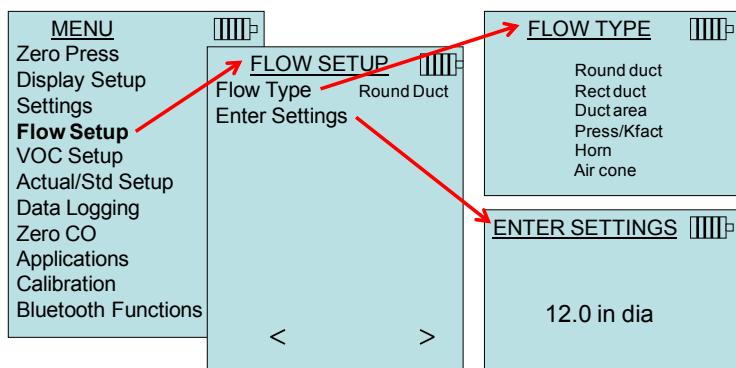

**Round duct, Rect duct and Duct area** are used to perform a duct traverse using a pitot probe or thermoanemometer probe.

**Press/Kfact** allows for calculating flow rate from diffusers or flow stations with pressure taps using the instruments pressure ports and Kfactors. The Kfactors are obtained from the diffuser or flow station manufacturer.

Up to 5 rectangular ducts, 5 round ducts, 5 duct areas and 5 Kfactors can be pre-programmed for quick use on a jobsite:

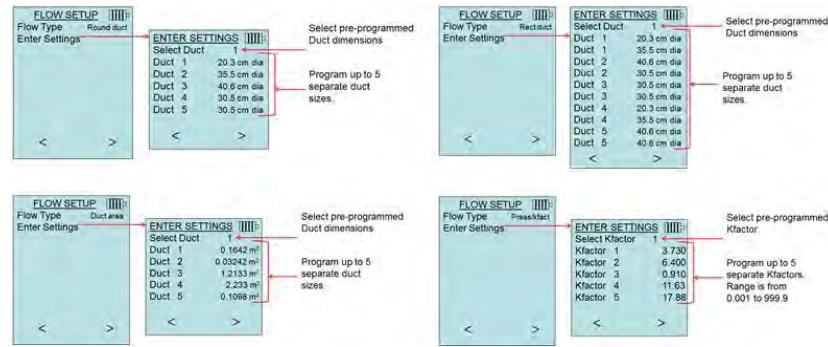


When **Flow** is set as the **Primary** measurement in the **Display Setup** menu, the dimensions or Kfactor will also be displayed:



#### NOTE

For flow measurements with round, rectangular, or duct area, velocity must be set as a secondary measurement in order for flow readings to appear when using the pitot or AF probe.

When measuring **Flow** as the **Primary** measurement, the parameters can be quickly changed by pressing the **▲** or **▼** key while on the main measurement screen:

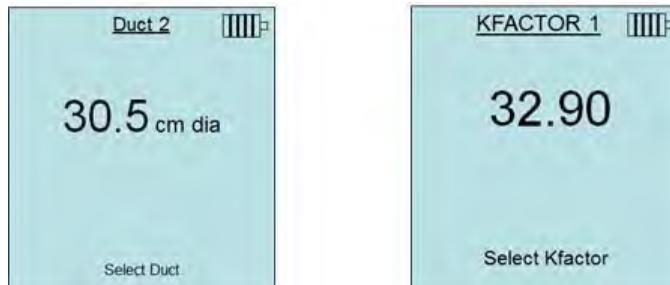

Make adjustments with the **▲** or **▼** arrow keys and press **◀** to accept, or enter the **Select Duct** or **Select Kfactor** menu to choose a different pre-programmed flow value or dimension.

The **Horn** numbers are the models of the horns. For example, 100 refers to a horn model number AM 100. Only horns with Model numbers as follows can be used with this function: AM 100, AM 300, AM 600 and AM 1200. If a horn model number is chosen, the instrument will return to measuring mode and use a preprogrammed curve to calculate flow rate from velocity when using a thermoanemometer probe.


The **Air cone** selection applies to the Model 995 Rotating Vane Anemometer and the Air Cone kit p/n 801749 which are used to take flow measurements on small outlets.

#### **VOC SETUP**

This menu item applies to TSI probes that measure Volatile Organic Compounds (VOC). Refer to the manual included with VOC probe Models 984, 985, 986, and 987 for information on usage and setup.

## ACTUAL/STANDARD SETUP

Choose **Actual/Standard** measurements and parameters in the Act/Std Setup menu. The Model 9565 measures the actual barometric pressure using an internal sensor. The temperature source can be entered manually or taken from a probe that measures temperature (plug in probe or thermocouple). The Entered Temp range is from -40 to 1832°F (-40 to 1000°C).

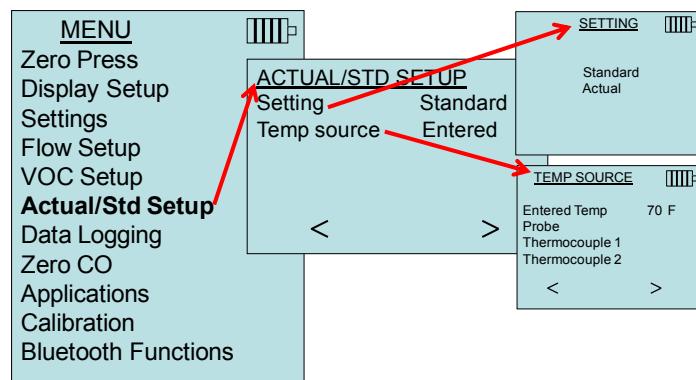


## DATA LOGGING

### Measurements

Measurements to be logged to memory are independent of measurements on the display, and must therefore be selected under **DATA LOGGING** → **Measurements**.

- When set to **ON**, measurement will be logged to memory.
- When set to **DISPLAY**, measurement will be logged to memory if it is visible on the main running screen.
- When set to **OFF**, measurement will not be logged to memory.

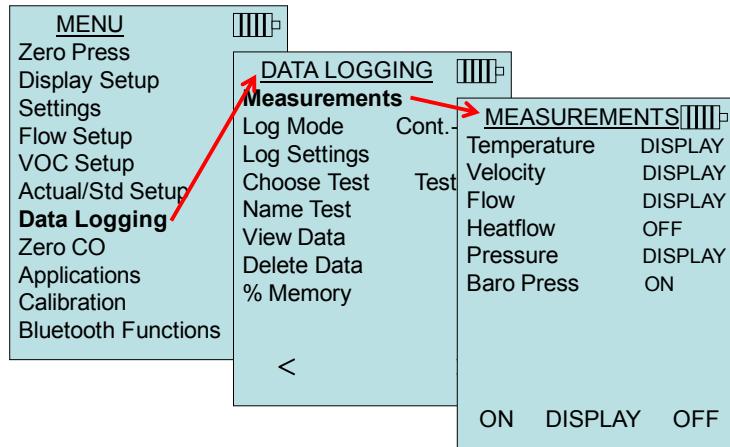

### N O T E

Pitot Velocity and AFProbe Velocity cannot both be ON at the same time, nor can one be set to PRIMARY and the other to ON. Only one can be ON at any given time.

### Log Mode/Log Settings

The 9565 can be programmed to store measurements to memory in several different logging formats:


- Manual
- Auto-save
- Cont-key
- Cont-time
- Program 1
- Program 2

### Manual Logging

Manual mode does not automatically save data, but instead prompts the user to **SAVE** a sample or **ESC** to not save. To start logging, press the **←** key.


#### NOTE

To adjust the averaging period for a sample when using Manual logging, change the Time Constant (increase or decrease in seconds) which is located in the Settings Menu.

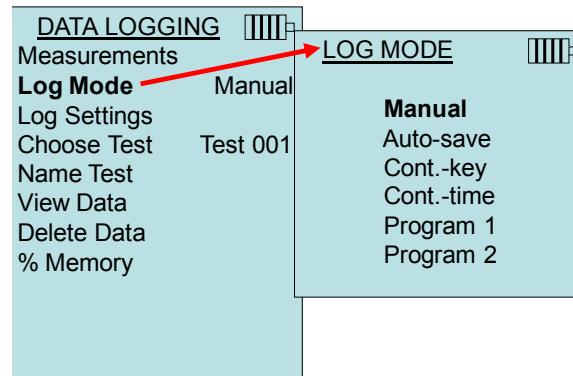


### Auto Save Logging

In Auto-save mode, the user samples are automatically logged to memory at the end of the sampling period. To start logging, press the **←** key.

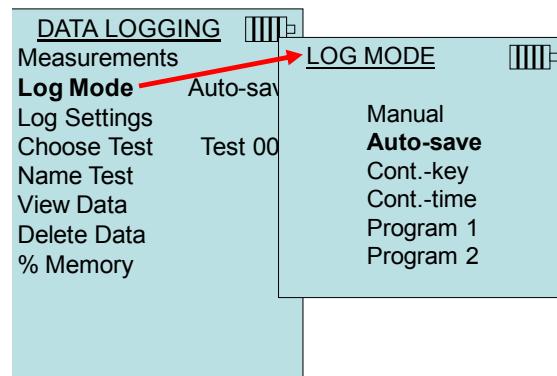


When set to **Auto-save**, the Sample Time can be adjusted. Sample Time is the time period over which the Sample will be averaged.

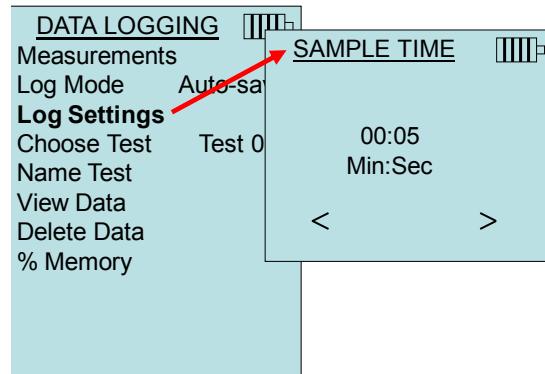


#### Cont-key Logging

In **Cont-key** mode, the user starts logging by pressing the  $\leftarrow$  key. The instrument will continue logging until the  $\leftarrow$  key is pressed again.

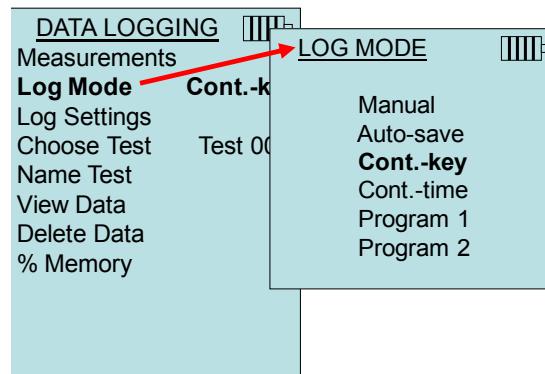

When set to **Cont. key**, the log interval can be adjusted.

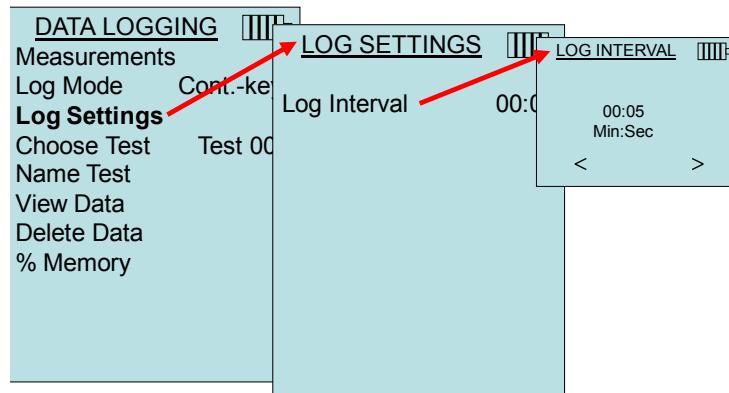


#### NOTE


Pressing the **▲▼** keys simultaneously will lock the keypad to prevent unauthorized adjustments to the instruments during unattended logging. A "Lock" symbol will appear on the display. To unlock the keypad, press the **▲▼** keys simultaneously. The "Lock" symbol will disappear.

#### Cont-time Logging

In **Cont-time** mode, the user starts taking readings by pressing the **↔** key. The instrument will continue taking samples until the time as set in "Test Length" has elapsed.

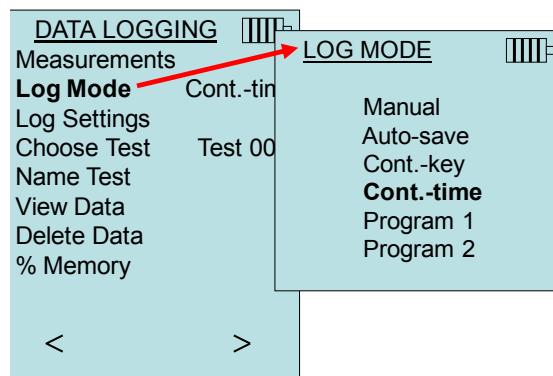

When set to **Cont.-time**, the log interval and test length can be adjusted.


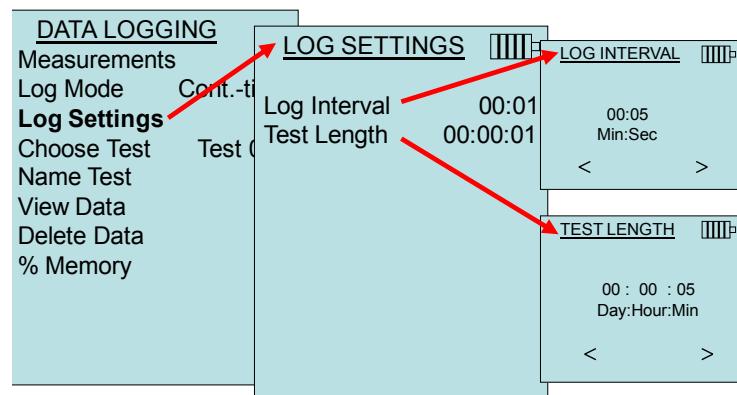


#### NOTE

Pressing the **▲▼** keys simultaneously will lock the keypad to prevent unauthorized adjustments to the instruments during unattended logging. A “Lock” symbol will appear on the display. To unlock the keypad, press the **▲▼** keys simultaneously. The “Lock” symbol will disappear.

### Program 1 and Program 2

**Program 1** and **Program 2** are customized data logging setup programs. Setting them up is performed using TSI's TrakPro™ Data Analysis software.

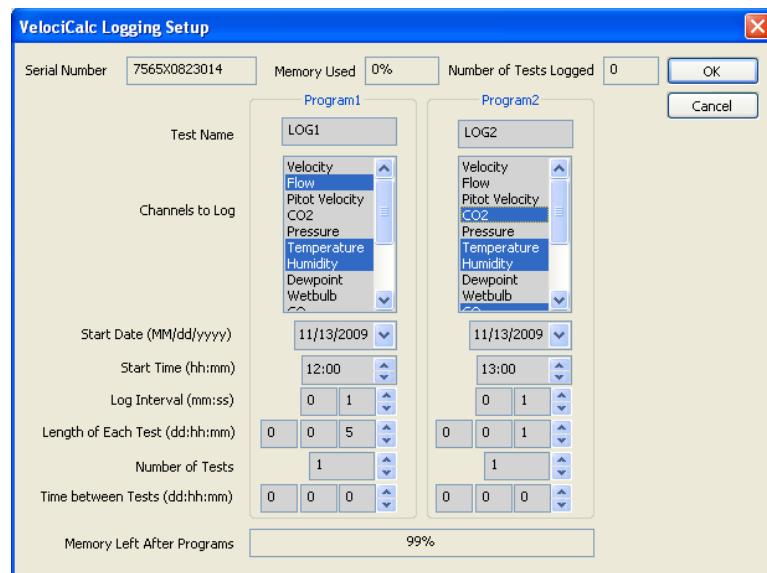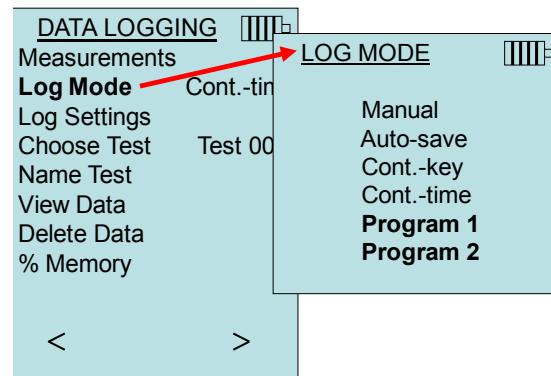

For more information, refer to the TrakPro Data Analysis Software User's Guide which can be found on the TrakPro software CD which is included with the 9565.

---


TrakPro is a trademark of TSI Incorporated.

### Choose Test

Test IDs consist of a group of Samples that are used to determine statistics (average, minimum, and maximum) of a measurement application. The 9565 can store 26,500+ samples and 100 test IDs (one sample can contain fourteen measurement types).


Example: Each duct traverse will have its own Test ID consisting of several Samples.

Pressing **NEW** will advance to the next available Test ID. Pressing **DATES** will list the date the Test was taken.

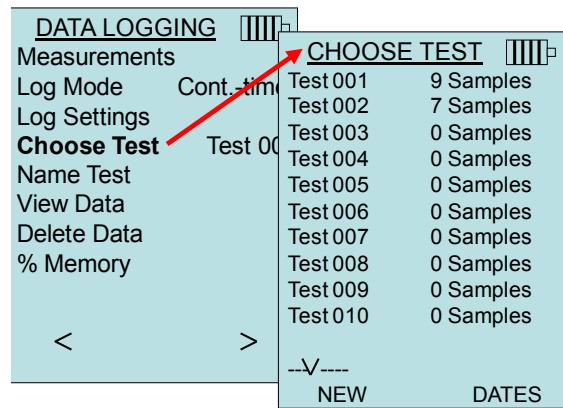

### Name Test


This option allows for customizing the Test ID name using 8 characters maximum. Use the arrow keys to move the cursor to a desired location, press **←** to accept. Repeat until the desired name appears. Press **SAVE** to store custom ID name.

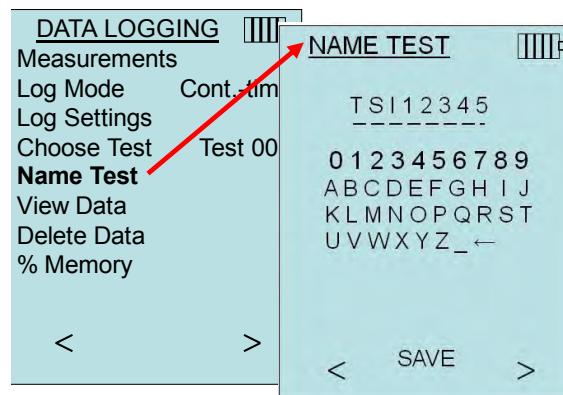

## View Data


### Choose Test

To view stored data, first select the Test ID that contains the data to be recalled. This is accomplished in the “Choose Test” menu.

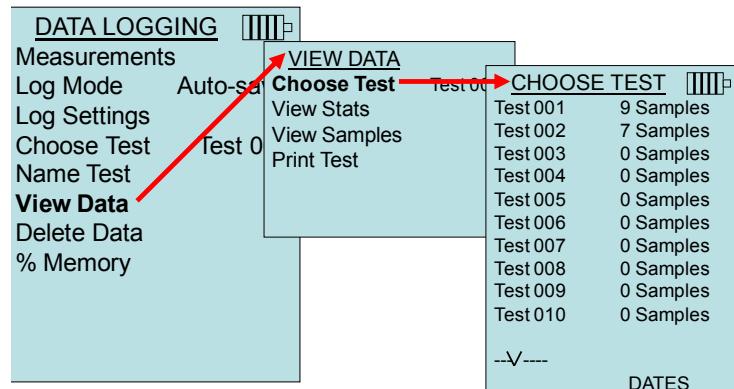


### View Stats

Displays statistics (average, minimum, and maximum) of a selected Test ID and the number of samples, date and time the samples were taken.

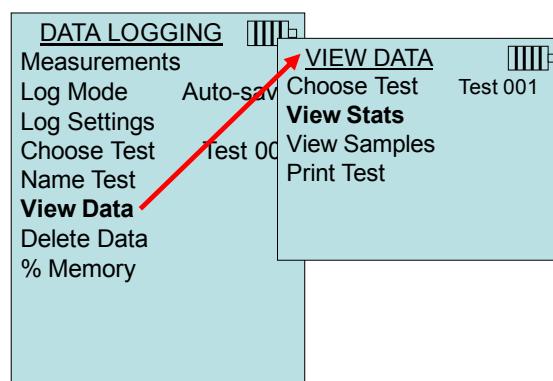


Use the < and > arrow keys to view statistics of all the measurement parameters stored in a Test ID.

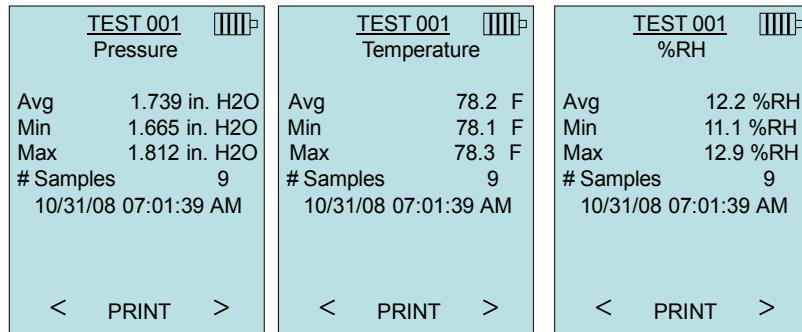

Example: TEST 001 has 9 samples, each sample consists of a pressure, temperature, and relative humidity reading. Use the < or > keys to view statistics of each measurement parameter.

The 9565-P and 9565-X can send this data to the optional Model 8934 wireless printer or PC capable of Bluetooth communications. To use the PRINT command, Bluetooth communications must be established between the instrument and the Model 8934 wireless printer or PC set up with Bluetooth communications.

#### **View Samples**

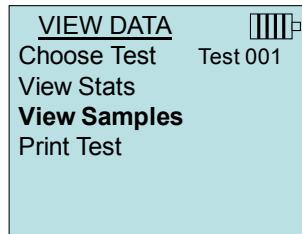


Use the **<** and **>** arrow keys to view samples of all the measurement parameters stored in a Test ID.

TEST 001	
Velocity	
Sample 1	218 ft/min
Sample 2	280 ft/min
Sample 3	316 ft/min
Sample 4	399 ft/min
Sample 5	188 ft/min
Sample 6	306 ft/min
Sample 7	313 ft/min
Sample 8	294 ft/min
Sample 9	309 ft/min
<	>
PRINT	
TEST 001	
Temperature	
Sample 1	73.5 F
Sample 2	73.7 F
Sample 3	73.8 F
Sample 4	73.8 F
Sample 5	73.6 F
Sample 6	73.6 F
Sample 7	73.5 F
Sample 8	73.4 F
Sample 9	73.4 F
<	>
PRINT	
TEST 001	
%rh	
Sample 1	15.1%rh
Sample 2	14.2%rh
Sample 3	13.8%rh
Sample 4	13.8%rh
Sample 5	13.5%rh
Sample 6	13.6%rh
Sample 7	13.6%rh
Sample 8	13.5%rh
Sample 9	13.5%rh
<	>
PRINT	

The 9565-P and 9565-X can send this data to the optional Model 8934 wireless printer or PC capable of Bluetooth communications. To use the **PRINT** command, Bluetooth communications must be established between the instrument and the Model 8934 wireless printer or PC set up with Bluetooth communications.

### Print Test


Press **<→** to print all statistics and samples for the selected Test ID.

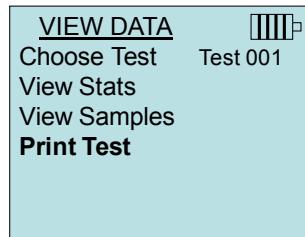


The 9565-P and 9565-X can send this data to the optional Model 8934 wireless printer or PC capable of Bluetooth communications. To use the **PRINT** command, Bluetooth communications must be established between the instrument and the Model 8934 wireless printer or PC set up with Bluetooth communications.

## Delete Data


Use this to delete all data, delete test or delete sample.

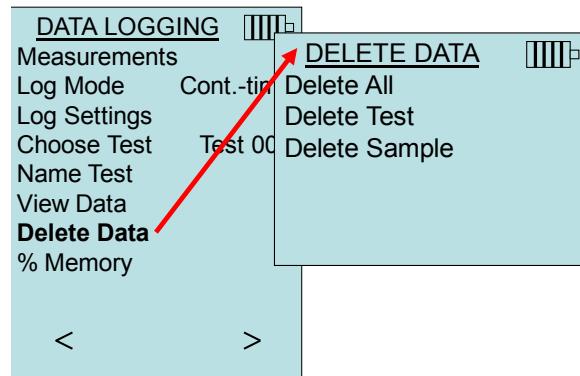


Delete All will clear stored data in all Test IDs.

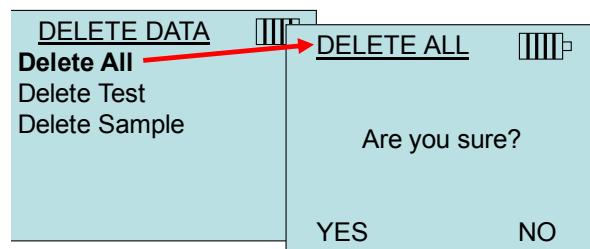

Delete Test will clear stored data in an individual Test ID selected by the user.

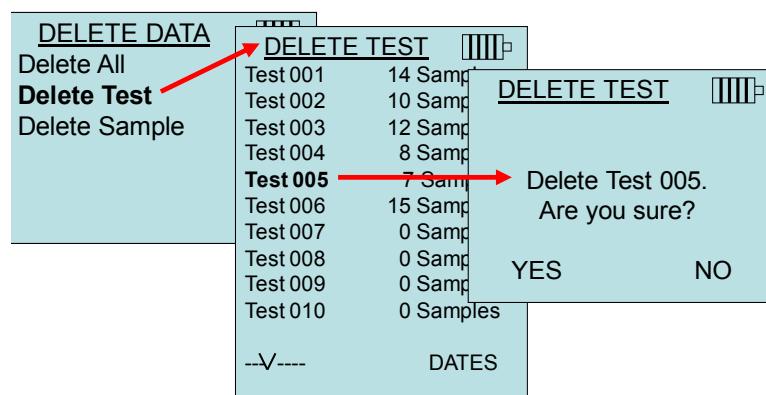


**Delete Sample** will clear the last sample in an individual Test ID selected by the user.

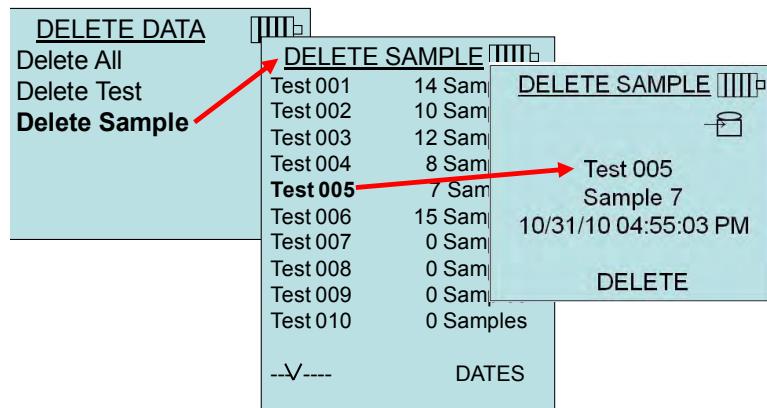


#### % Memory

This option displays the memory available. **Delete All**, under **Delete Data**, will clear memory and reset the memory available to 100%.

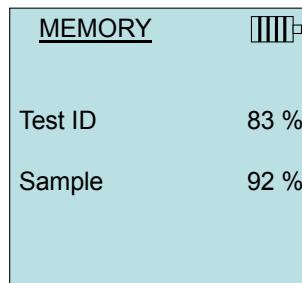

## **ZERO CO**

This menu item applies to TSI probe Model 982 which can measure carbon monoxide (CO). Turn the instrument on for a minimum of five minutes to let it warm up before zeroing the CO sensor. Zero CO will zero the CO sensor readings that may have drifted. Initiating the Zero CO function will show the sensor CO reading and the time remaining.

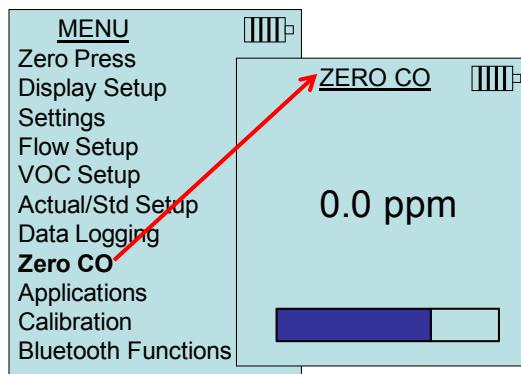


### **N O T E**

The Zero CO function should be performed in an area where no combustion is taking place which may affect zeroing of the sensor.

## APPLICATIONS


This menu option includes specialized measurement protocols used to perform various tests or investigations. You can choose Draft Rate, Heat flow, Turbulence, % Outside Air, and Leakage Test in the Applications menu. For more information on these applications, refer to the following information:

- Draft Rate: Application Note TSI-142
- Heat Flow: Application Note TSI-124
- Turbulence Intensity: Application Note TSI-141
- Percent Outside Air: Application Note TSI-138
- Leakage Test: PANDA Manual

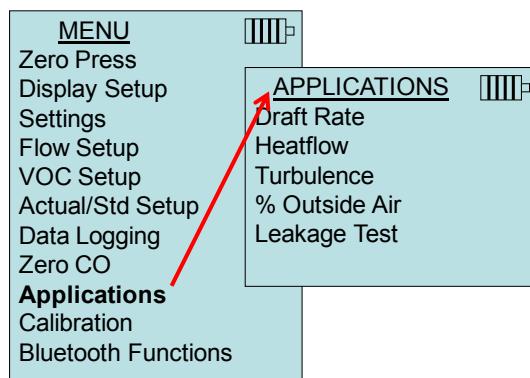


## CALIBRATION

The Calibration Menu lists measurement parameters that can be adjusted in the field. The appropriate detachable probes must be attached to the 9565 before field calibration can be undertaken except for pressure and barometric pressure calibration.

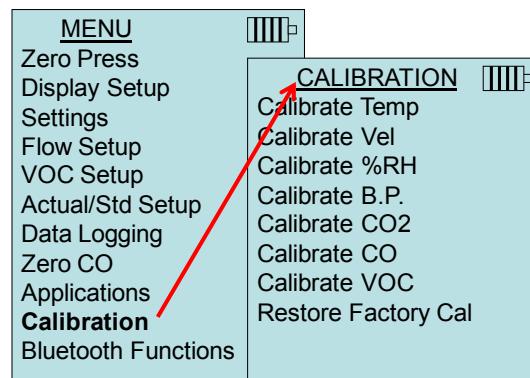

## BLUETOOTH FUNCTIONS (Models 9565-P and 9565-X only)

VelociCalc Models 9565-P and 9565-X contains a Bluetooth Functions menu which is used to adjust parameters to assist with wireless connections to other Bluetooth capable devices.

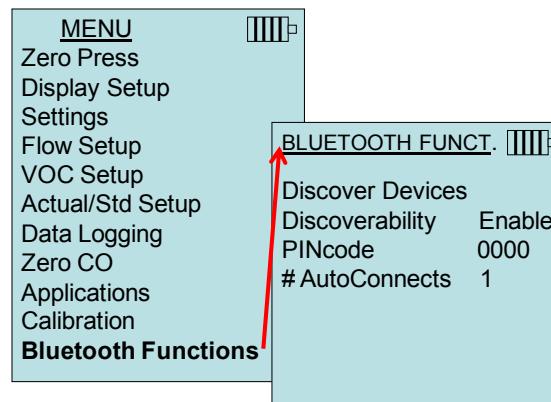

### Discover Devices

Start the Bluetooth process of finding other devices from the VelociCalc Model 9565-P or 9565-X.

### Discoverability

Describes whether another device can discover the VelociCalc Model 9565-P or 9565-X meter. Options include:

<b>Disable</b>	The instrument is not discoverable by other devices.
<b>Temporary</b>	Allows the instrument to be discoverable until another device pairs with it or until the instrument power is turned off and back on.
<b>Enable</b>	Makes the instrument discoverable indefinitely.

### PINcode

The PINcode is a security key to be entered into the computer if prompted. The factory default PINcode is **0000**.

#### NOTE

PINcode must be set to **0000** in order to use 8934 printer.

### # AutoConnects

Specifies how many times the instrument will attempt to reattach to a paired device after the power is turned on. For this option, the instrument Discoverability setting must be enabled. Settings are 0 to 5 times.

### Printing Data Using the Portable Printer (Models 9565-P and 9565-X only)

To print logged data, first enter the DATALOGGING menu. Then, use the **CHOOSE TEST** item to select the data to be printed. After the test is selected, use the **VIEW STATS** and **VIEW SAMPLES** items to select statistics or individual data points to view and print. After selecting **VIEW STATS** or **VIEW SAMPLES**, press the **PRINT** key to print the data.

### **TrakPro™ Data Analysis Software**

The VelociCalc Model 9565 comes with special software called TrakPro™ Data Analysis Software, which is designed to provide you with maximum flexibility and power.

Follow the instructions on the label of the TrakPro software to install the software on your computer. TrakPro software contains a very comprehensive Help Function. This utility provides all the necessary information to guide you in all aspects of software operation.

To download data from the Model 9565, connect the supplied computer interface USB cable to the Model 9565 and to a computer USB port. Any USB port can be used.

### **LogDat2™ Downloading Software**

The VelociCalc Model 9565 also includes downloading software called LogDat2. LogDat2 software transfers the stored data from the Model 9565 to a computer as a spreadsheet file. This software is useful for applications such as duct traverses, fume hood, and filter face velocity testing.

Follow the instructions on the label of the LogDat2 software to install the software on your computer. The software is shipped on a CD-ROM and includes a User's Guide and Installation Instructions.

To download data from the Model 9565, connect the supplied computer interface USB cable to the Model 9565 and to a computer USB port. Any USB port can be used.

## Chapter 4

### **Maintenance**

---

The Model 9565 and probe accessories require very little maintenance to keep it performing well.

#### **Recalibration**

To maintain a high degree of accuracy in your measurements, we recommend that you return your Model 9565, 960 series thermoanemometer probes, IAQ and VOC probes to TSI for annual recalibration.

The Model 9565 and accessory probes can also be recalibrated in the field using the **CALIBRATION** menu. These field adjustments are intended to make minor changes in calibration to match a user's calibration standards. The field adjustment is **NOT** intended as a complete calibration capability. For complete, multiple-point calibration and certification, the instrument must be returned to the factory.

#### **Cases**

If the instrument case or storage case needs cleaning, wipe it off with a soft cloth and isopropyl alcohol or a mild detergent. Never immerse the Model 9565. If the enclosure of the Model 9565 or the AC adapter becomes broken, it must be replaced immediately to prevent access to hazardous voltage.

#### **Storage**

Remove the batteries when storing the unit for more than one month to prevent damage due to battery leakage.

## Chapter 5

### **Troubleshooting**

Table 5-1 lists the symptoms, possible causes, and recommended solutions for common problems encountered with the Model 9565. If your symptom is not listed, or if none of the solutions solves your problem, please contact TSI.

**Table 5-1: Troubleshooting the Model 9565**

Symptom	Possible Causes	Corrective Action
No Display	Unit not turned on	Switch unit on.
	Low or dead batteries	Replace batteries or plug in AC adapter.
	Dirty battery contacts	Clean the battery contacts.
Velocity reading fluctuates unstable	Fluctuating flow	Reposition probe in less turbulent flow or use longer time constant.
No response to keypad	Keypad locked out	Unlock keypad by pressing <b>▲▼</b> keys simultaneously.
Instrument Error message appears	Memory is full	Download data if desired, then <b>DELETE ALL</b> memory.
	Fault in instrument	Factory service required on instrument.
Probe Error message appears	Fault in probe	Factory service required on probe.
Probe is plugged in, but the instrument does not recognize it	Probe was plugged in when the instrument was ON	Turn instrument OFF and then turn it back ON.

#### **WARNING!**

Remove the probe from excessive temperature immediately: excessive heat can damage the sensor. Operating temperature limits can be found in [Appendix A, Specifications](#). The pressure sensor is protected from damage up to 7 psi (48 kPa or 360 mmHg). At higher pressure it can burst!

## Appendix A

### Specifications

---

Specifications are subject to change without notice.

#### **Velocity (TA Probe):**

Range: 0 to 9999 ft/min (0 to 50 m/s)  
Accuracy<sup>1&2</sup>:  $\pm 3\%$  of reading or  $\pm 3$  ft/min ( $\pm 0.015$  m/s), whichever is greater  
Resolution: 1 ft/min (0.01 m/s)

#### **Velocity (Pitot Tube):**

Range<sup>3</sup>: 250 to 15500 ft/min (1.27 to 78.7 m/s)  
Accuracy<sup>4</sup>:  $\pm 1.5\%$  at 2000 ft/min (10.16 m/s)  
Resolution: 1 ft/min (0.01 m/s)

#### **Duct Size:**

Range: 1 to 500 inches in increments of 0.1 in.  
(2.5 to 1270 cm in increments of 0.1 cm)

#### **Volumetric Flow Rate:**

Range: Actual range is a function of actual velocity, pressure, duct size, and K factor

#### **Temperature (TA Probe):**

Range: 14 to 140°F (-10 to 60°C)  
Accuracy<sup>5</sup>:  $\pm 0.5^{\circ}\text{F}$  ( $\pm 0.3^{\circ}\text{C}$ )  
Resolution: 0.1°F (0.1°C)

#### **Relative Humidity (TA Probe):**

Range: 5 to 95% RH  
Accuracy<sup>6</sup>:  $\pm 3\%$  RH  
Resolution: 0.1% RH

#### **Wet Bulb Temperature (TA Probe):**

Range: 40 to 140°F (5 to 60°C)  
Resolution: 0.1°F (0.1°C)

#### **Dew Point (TA Probe):**

Range: 5 to 120°F (-15 to 49°C)  
Resolution: 0.1°F (0.1°C)

#### **Heat Flow (TA Probe):**

Range: Function of velocity, temperature, humidity, and barometric pressure  
Measurements available: Sensible heat flow, latent heat flow, total heat flow and sensible heat factor  
Units measured: BTU/hr, kW

**Static / Differential Pressure:**

Range<sup>7</sup>: -15 to +15 in. H<sub>2</sub>O (-28.0 to +28.0 mm Hg, -3735 to +3735 Pa)  
Accuracy:  $\pm 1\%$  of reading  $\pm 0.005$  in. H<sub>2</sub>O ( $\pm 1$  Pa,  $\pm 0.01$  mm Hg)  
Resolution: 0.001 in. H<sub>2</sub>O (0.1 Pa, 0.01 mm Hg)

**Barometric Pressure:**

Range: 20.36 to 36.648 in. Hg (517.15 to 930.87 mm Hg)  
Accuracy:  $\pm 2\%$  of reading

**Instrument Temperature Range:**

Operating (Electronics): 40 to 113°F (5 to 45°C)  
Operating (Probe): 14 to 140°F (-10 to 60°C)  
Storage: -4 to 140°F (-20 to 60°C)

**Instrument Operating Conditions:**

Altitude up to 4000 meters  
Relative humidity up to 80% RH, non-condensing

**Data Storage Capabilities:**

Range: 26,500+ samples and 100 test IDs (one sample can contain fourteen measurement types)

**Logging Interval:**

Intervals: 1 second to 1 hour

**Time Constant:**

Intervals: User selectable

**Response Time:**

Velocity: 200 msec  
Temperature: 2 minutes (to 66% of final value)  
Pressure: 0.1 msec  
Humidity: <1 minute (to 66% of final value)

**External Meter Dimensions:**

3.8 in.  $\times$  8.3 in.  $\times$  2.1 in. (9.7 cm  $\times$  21.1 cm  $\times$  5.3 cm)

**Meter Probe Dimensions:**

Probe length: 40 in. (101.6 cm)  
Probe diameter of tip: 0.28 in. (7.0 mm)  
Probe diameter of base: 0.51 in. (13.0 mm)

**Articulating Probe Dimensions:**

Articulating section length: 6.0 in. (15.24 cm)  
Diameter of articulating knuckle: 0.38 in. (9.5 mm)

**Meter Weight:**

Weight with batteries: 0.8 lbs (0.36 kg)

**Power Requirements:**

Four AA-size batteries (included) or  
AC Adapter p/n 801761

Input: 90 to 240 VAC, 50 to 60 Hz  
Output: 9 VDC, 2A

- 1 Temperature compensated over an air temperature range of 40 to 150°F (5 to 65°C).
- 2 The accuracy statement of  $\pm 3.0\%$  of reading or  $\pm 3$  ft/min ( $\pm 0.015$  m/s), whichever is greater, begins at 30 ft/min through 9999 ft/min (0.15 m/s through 50 m/s).
- 3 Pressure velocity measurements are not recommended below 1000 ft/min (5 m/s) and are best suited to velocities over 2000 ft/min (10.00 m/s). Range can vary depending on barometric pressure.
- 4 Accuracy is a function of converting pressure to velocity. Conversion accuracy improves when actual pressure values increase.
- 5 Accuracy with instrument case at 77°F (25°C), add uncertainty of 0.05°F/°F (0.03°C/°C) for change in instrument temperature.
- 6 Accuracy with probe at 77°F (25°C). Add uncertainty of 0.1% RH/°F (0.2% RH/°C) for change in probe temperature. Includes 1% hysteresis.
- 7 Overpressure range = 190 in. H<sub>2</sub>O (7 psi, 360 mmHg, 48 kPa).

## Appendix B

### Optional Plug-in Probes

<b>Thermoanemometer Probes</b>	
<b>Model</b>	<b>Description</b>
960	Air Velocity and Temperature, Straight Probe
962	Air Velocity and Temperature, Articulating Probe
964	Air Velocity, Temperature, and Humidity, Straight Probe
966	Air Velocity, Temperature, and Humidity, Articulating Probe

<b>Rotating Vane Anemometer Probes</b>	
<b>Model</b>	<b>Description</b>
995	4 in. (100 mm) Rotating Vane, Air Velocity, and Temperature

<b>Temperature and Relative Humidity Probe</b>	
<b>Model</b>	<b>Description</b>
800220	Temperature and humidity probe

<b>Indoor Air Quality (IAQ) Probes</b>	
<b>Model</b>	<b>Description</b>
980	Indoor Air Quality Probe, Temperature, Humidity, CO <sub>2</sub>
982	Indoor Air Quality Probe, Temperature, Humidity, CO <sub>2</sub> and CO

<b>Volatile Organic Compounds (VOC) Probes</b>	
<b>Model</b>	<b>Description</b>
984	Low Concentration (ppb) VOC and Temperature
985	High Concentration (ppm) VOC and Temperature
986	Low Concentration (ppb) VOC, Temperature, CO <sub>2</sub> , and Humidity
987	High Concentration (ppm) VOC, Temperature, CO <sub>2</sub> , and Humidity

<b>K-alloy Thermocouple Probes</b>	
<b>Model</b>	<b>Description</b>
792	Surface Temperature Probe
794	Air Temperature Probe

<b>Pitot Probes</b>	
<b>Model</b>	<b>Description</b>
634634000	Pitot Probe 12" (30 cm) - 5/16" (8 mm) diameter
634634001	Pitot Probe 18" (46 cm) - 5/16" (8 mm) diameter
634634002	Pitot Probe 24" (61 cm) - 5/16" (8 mm) diameter
634634003	Pitot Probe 36" (91 cm) - 5/16" (8 mm) diameter
634634005	Pitot Probe 60" (152 cm) - 5/16" (8 mm) diameter
634634004	Telescoping Pitot Probe - 8" to 38" (20 cm to 96 cm)
800187	Air Flow Probe (Straight Pitot) 18" (46 cm) - 5/16" (8 mm) diameter